

SHOE NAIL 2637 1370.B. - HYPOEUTECTOID STEEL - ROMAN TIMES - SWITZERLAND

Artefact name	Shoe nail 2637 1370.B.
Authors	Christian. Degrigny (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland) & Valentin. Boissonnas (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland) & Vincent Chappuis. (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland)
Url	/artefacts/1248/

▼ The object



Credit HE-Arc CR, V.Chappuis.

Fig. 1: A Roman shoe nail from a block taken from an excavation site before conservation.

▼ Description and visual observation

Description of the artefact	A Roman shoe nail from a block taken from an excavation site (Fig. 1) covered with a thick corrosion crust. The forged nails were hammered into the leather soles on a bucking tool. Average dimensions of the shoe nails: L = about 14mm; diameter = 11mm; W = up to 0.8g.
Type of artefact	clothing element
Origin	Hofstetterfeld, near Roman Necropolis, Sursee, Lucerne, Switzerland
Recovering date	Unknown
Chronology category	Roman Times
chronology tpq	<input type="text" value="50"/> A.D. ▾
chronology taq	<input type="text" value="100"/> A.D. ▾
Chronology comment	2nd half 1st century AD.
Burial conditions / environment	Soil
Artefact location	Denkmalpflege und Archäologie des Kantons, Luzern
Owner	Denkmalpflege und Archäologie des Kantons, Luzern
Inv. number	2637 1370.B.
Recorded conservation data	Block-lifted (in plaster), desiccated storage with silica gel.

Complementary information

Burial environment: dense sand-clay soil, humid.

▼ Study area(s)



Credit HE-Arc CR, V.Chappuis.

Fig. 2: Incomplete shoe from which the nail was sampled (in red circle).

▼ Binocular observation and representation of the corrosion structure

The schematic representation below gives an overview of the corrosion layers encountered on the nail from a first visual macroscopic observation.

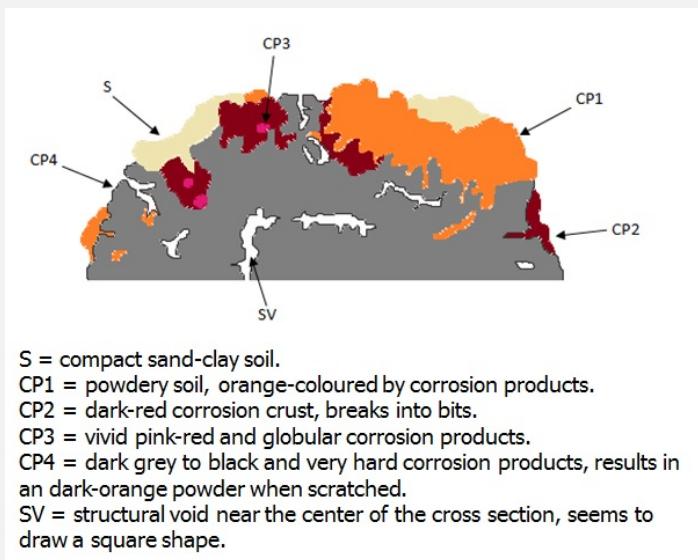



Fig. 3: Preliminary stratigraphy of the corrosion layers based on the observation of a broken nail,

S = compact sand-clay soil.
CP1 = powdery soil, orange-coloured by corrosion products.
CP2 = dark-red corrosion crust, breaks into bits.
CP3 = vivid pink-red and globular corrosion products.
CP4 = dark grey to black and very hard corrosion products, results in a dark-orange powder when scratched.
SV = structural void near the center of the cross section, seems to draw a square shape.

Credit HE-Arc CR, V.Chappuis.

▼ MiCorr stratigraphy(ies) – Bi

▼ Sample(s)

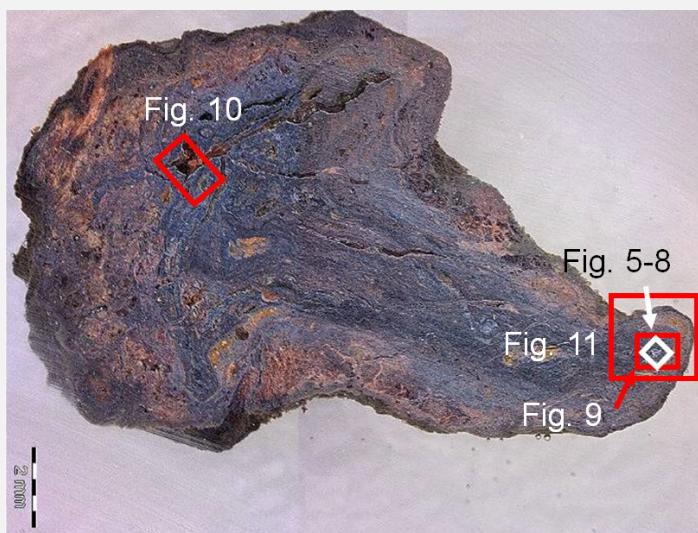

Credit HE-Arc CR, V.Chappuis.

Fig. 4: Micrograph of the cross-section of the nail showing the location of figs. 5 to 11,

Description of sample	A longitudinal cut through the nail (Fig. 4). Dimensions: L = 16.4mm; W = about 12.0mm.
Alloy	Hypoeutectoid steel
Technology	Forged
Lab number of sample	HE-Arc CR 1457-S1.
Sample location	HE-Arc CR, Neuchâtel, Neuchâtel
Responsible institution	HE-Arc CR, Neuchâtel, Neuchâtel
Date and aim of sampling	2013, metallography and elementary composition of the metal

Complementary information

None.

▼ Analyses and results

Analyses performed:

Metallography (Nital etched), SEM/EDS.

▼ Non invasive analysis

None.

▼ Metal

The remaining metal is an hypoeutectoid steel (Fig. 5 and 6), containing Fe, Si and O slags inclusions (possibly fayalite $FeO\cdot SiO_2$), and consisting of less than 1% of the total volume of the highly mineralized nail. After Nital etching, it shows intergranular corrosion on one of its sides (Figs. 7 and 8).

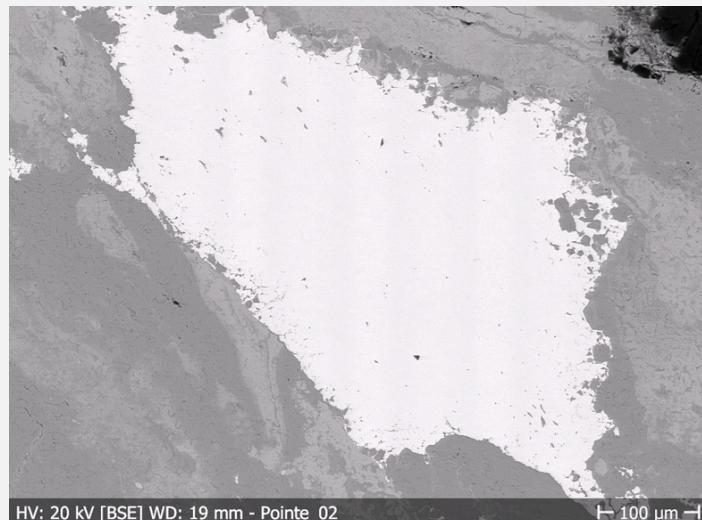


Fig. 5: SEM, BSE-mode picture of remaining metal from cross-section of Fig. 4,



Fig. 6: SEM, BSE-mode picture of inclusions in remaining metal (detail of Fig. 5).

HV: 20 kV [BSE] WD: 19 mm - Pointe_03

Credit HEI Arc, S.Ramseyer.

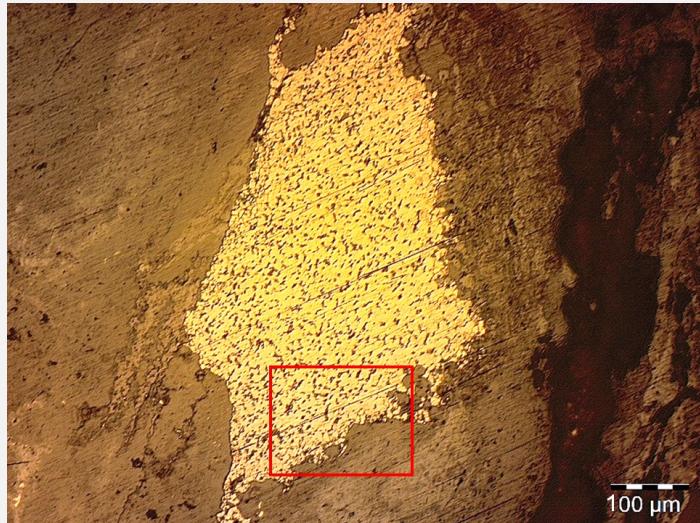


Fig. 7: Micrograph of the metal sample from Fig. 5 (detail, rotated 90°), Nital etched, bright field, with indication of Fig. 8 (red rectangle)

Credit HEHE-Arc CR, V.Chappuis.

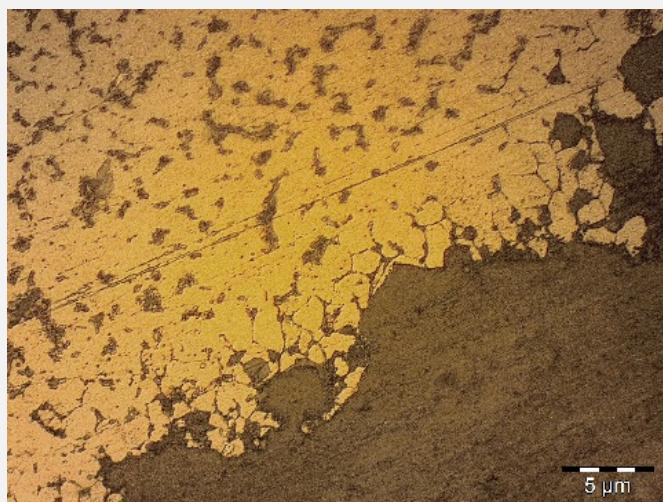


Fig. 8: Micrograph of the selected area of Fig. 7, Nital etched with no clear grain structure, bright field, Intergranular corrosion and grey phase (perlite?) are observed.

Credit HE-Arc CR, V.Chappuis.

Microstructure

Recrystallized grain structure

First metal element

Fe

Other metal elements

C

Complementary information

None.


▼ Corrosion layers

The metal is heavily corroded and the thickness of the corrosion crust is irregular, varying from 0.8 to 3.8mm, with an average of about 2mm. The corrosion has replaced most of the metal (Fig. 4). Between corrosion layers the limit of the original structure is visible. Some leather fibers seem to be preserved as pseudomorphic structures in voids of the metal core (POM1, Figs. 9 and 10). The carbon mapping (Fig.11) shows the presence of carbon in these areas. This can also be due to the penetration of the mounting resin in the cracks.


Si, Al, P and K can be considered external markers, helping to determine the limit of the original surface (Fig. 11 and Table 1). The outer layer of corrosion products (CP1-3) ranges from dark grey to orange in bright field and contains less O and Fe on its borders than the inner layer (CP4-5, Figs. 4 and 11, Table 1). The SEM pictures show a marbling appearance of the inner corrosion layer (CP5). Cl and S do not seem to be present in the sampled nail.

Layers	Elements	Fe	O	C	Al	Si	K	P
S1		Y-	Y	N	Y++	Y+	Y	Y-
CP1		Y	Y	Y-	Y	Y	Y-	Y
CP2		NA	NA	NA	NA	NA	NA	NA
CP3		NA	NA	NA	NA	NA	NA	NA
CP4		Y+	Y+	N	Y-	Y-	N	Y-
CP5		Y+	Y+	N	N	N	N	Y--
NMM		N	Y	N	N	Y++	N	NA
POM		Y+	Y-	Y	N	N	N	N
SV		N	N*	Y	Y-	N	N	N
M1		Y++	N	N**	N	N	N	Y--


Table 1: Elementary presences in stratigraphic layers based on SEM-EDS elemental mapping (Fig. 13). Y = yes; N = no; NA = not applicable (not observed). + = more compared to other layers; - = less compared to other layers. *Probably pushed back by coating resin. **Though SEM-EDS analysis showed that the metal is an iron-carbon alloy with inclusions of Si, Al, P and K.

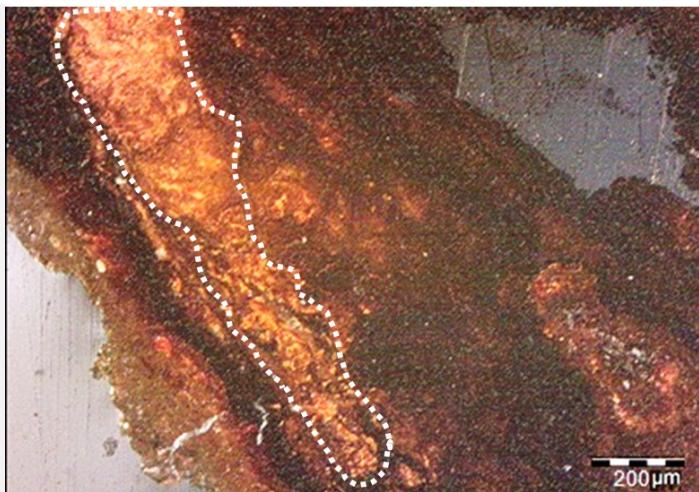

Credit HE-Arc CR, V.Chappuis.

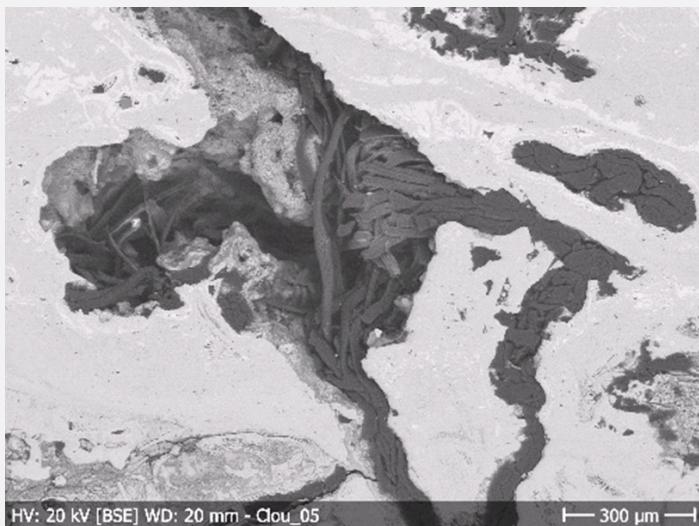

Credit He-Arc CR, S.Ramseyer.

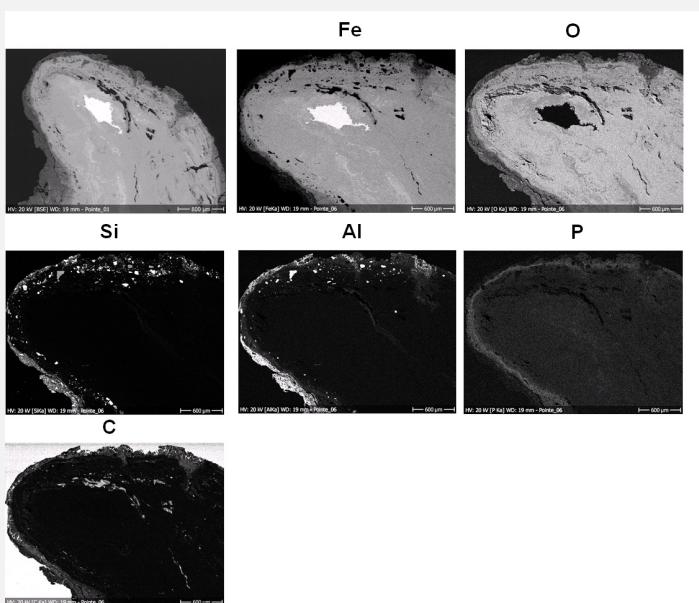

HN: 20 KV [C.Kg] WD: 10 mm - Pointe_06 600 µm Credit HE-Arc CR, S.Ramseyer.

Corrosion form Uniform - intergranular

Corrosion type aerated soil

Complementary information

None

Fig. 9: Micrograph of the metal sample from Fig. 4, bright field. The delimitated zone shows what could be leather pseudomorphic fibers filling a void,

Fig. 10: SEM - BSE-mode picture of another void filled with fibers in the head of the nail (see Fig. 4),

Fig. 11: Elemental chemical distribution of the selected area from Fig. 4 (90° counter-clockwise rotated). SEM-EDS.

▼ MiCorr stratigraphy(ies) – CS

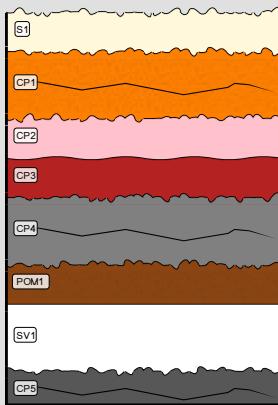


Fig. 12: Stratigraphic representation of the nail in cross-section (dark field) using the MiCorr application. The characteristics of the strata are only accessible by clicking on the drawing that redirects you to the search tool by stratigraphy representation. This representation can be compared to Fig. 14, Credit HE-Arc CR, V.Chappuis.

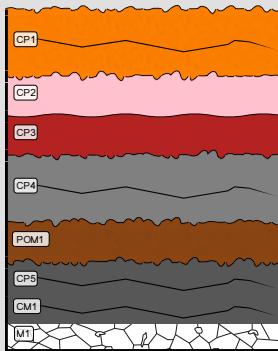


Fig. 13: Stratigraphic representation of the nail in cross-section (dark field) using the MiCorr application. The characteristics of the strata are only accessible by clicking on the drawing that redirects you to the search tool by stratigraphy representation. This representation can be compared to Fig. 14, Credit HE-Arc CR, V.Chappuis.

▼ Synthesis of the binocular / cross-section examination of the corrosion structure

The schematic representation of corrosion layers of Fig. 3 integrating additional information based on the analyses carried out is given in Fig. 14. The following strata were identified:

S1 = sand-clay soil, compact, cemented when dry, powdery when abraded, very thin particle size (usually about and less than 0.1mm). Undefined thickness (soil). CP1 = powdery orange (loosely coherent) and matte corrosion crust, sometimes forming humps. Partially mixed with S1 and POM layers (diffused interfaces). 1 to 5 millimeters thick.

CP2 = vivid red or pink dots, more brittle than powdery (loose cohesion) and mostly matte, only two or three observed, always above CP3 interfaces. Usually 1 mm spheric diameter.

CP3 = dark reddish corrosion product, forming smooth, matte and brittle layers that are parallel to CP4, with a clean and regular interface. The corrosion products are generally hard, but sometimes break up into grains, resulting in a more irregular interface. The layer is approximately 0.5mm thick.

CP4 = dark grey to black corrosion product, smooth with pseudo-metallic reflection (a bit glossy), very hard, when scratched results in orange powder, with somewhat irregular shape and thickness (ranging from 0.3 to 2mm).

CP5 = dark grey to black corrosion product, generally a bit darker than CP4. Smooth with pseudo-metallic reflection, even harder than CP4 and when scratched it turns into an orange coloured powder. Irregular interface regarding CP4. Clear transition and somewhat parallel from CP4 to CP5. As regards its thickness, it fills the remaining volume.

NMM = silica and calcareous inclusions.

POM = mostly powdery and grain-like material, ranging from orange to dark brown in colour, somewhat glossy and similar to crystals when illuminated. A few fiber-like zones are present, which are more satin than glossy. They are dark brown to charcoal black, very brittle and break into a powdery and grain-like material. POM is located above or close to CP3 and CP4 layers, sometimes mixed into S1 or CP1 layers with a diffused interface. Overall, the stratum is approximately 0.2-0.3mm thick.

SV = structural void, present as fissures that either pass through the different layers, or are present at corrosion interfaces, especially at the CP4/CP5 interface. The void is 0.1 to 0.3mm thick and partially filled with POM in the outer layers.

M1 = glossy with metallic reflection.

Stratigraphy, Fig. 12

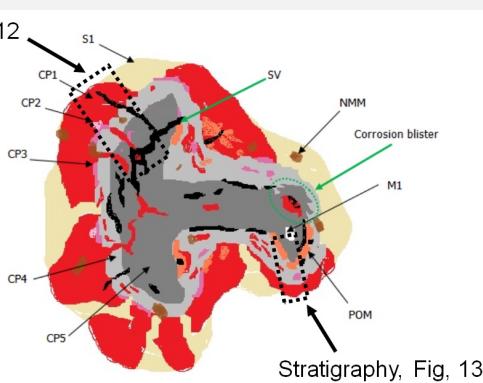


Fig. 14: Improved stratigraphic representation of the nail from visual observations and analyses and visualization of the two stratigraphies of Figs. 12 and 13,

▼ Conclusion

The nail is apparently made of a hypoeutectoid steel, with what may be a pearlite phase. Roman shoe nails are forged and pushed through leather soles by hammering them against a hard foot-shaped buckering device. This requires the steel to be strong, but not too brittle, otherwise it will be prone to breaking when pushed through the soles or when in use for marching on hard surfaces. This nail is almost entirely mineralized. Its original shape can be visualised within the corrosion layers. In addition to this, what appears to be leather fibers seem to be preserved in either mineralized or organic form.

▼ References

References on object and sample

References object

1. Volken, M. (2010) "Le fer et la peau: le cuir et ses outils en milieu urbain romain". In: Chardron-Picault Pascale (dir.). Aspects de l'artisanat en milieu urbain: Gaule et Occident romain. Actes du colloque international d'Autun, 20-22 septembre 2007. Revue Archéologique de l'Est, 28e supplément. RAE, Dijon, 415-424.
2. Volken, M. (2011) Volken Serge et Paccolat Olivier. "Les clous de chaussures du site de Pfyn: les bases d'une typo-chronologie." In: Paccolat Olivier (dir.). Pfyn/Finges, évolution d'un territoire de la plaine du Rhône. Le site archéologique de "Pfyn" (Valais, Suisse). Cahiers d'archéologie romande 121, Archaeologia Vallesiana 4, Lausanne, 315-388.