

AIRCRAFT REAR FASTENING PLATE VHS-497 – AL ALLOY – MODERN TIMES

Artefact name Aircraft rear fastening plate VHS-497

Authors Marianne. Senn (EMPA, Dübendorf, Zurich, Switzerland) & Christian. Degrieny (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland)

Url /artefacts/703/

≡ The object



Credit HE-Arc CR.

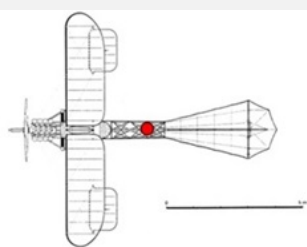


Fig. 1: Fastening plate from the back of the Dufaux IV (left) and top view of the aeroplane showing its location (red dot, right) (www.hepta.aero),

≡ Description and visual observation

Description of the artefact	Metal fastening plate for the wooden construction of the rear of the aeroplane (Fig. 1) covered with a thin corrosion layer.
Type of artefact	Aeroplane part
Origin	Dufaux IV aeroplane
Recovering date	Biplane built by Henri and Armand Dufaux in 1909/10
Chronology category	Modern Times
chronology tpq	1909 A.D. ▼
chronology taq	1910 A.D. ▼
Chronology comment	
Burial conditions / environment	Outdoor to indoor atmosphere
Artefact location	Swiss Museum of Transport, Luzern, Lucerne
Owner	Swiss Museum of Transport, Luzern, Lucerne
Inv. number	VHS-497
Recorded conservation data	Not known

Complementary information

Nothing to report.

Study area(s)



Credit HE-Arc CR.


Fig. 2: Location of sampling area,

Binocular observation and representation of the corrosion structure

Stratigraphic representation: none.

MiCorr stratigraphy(ies) – Bi

Sample(s)

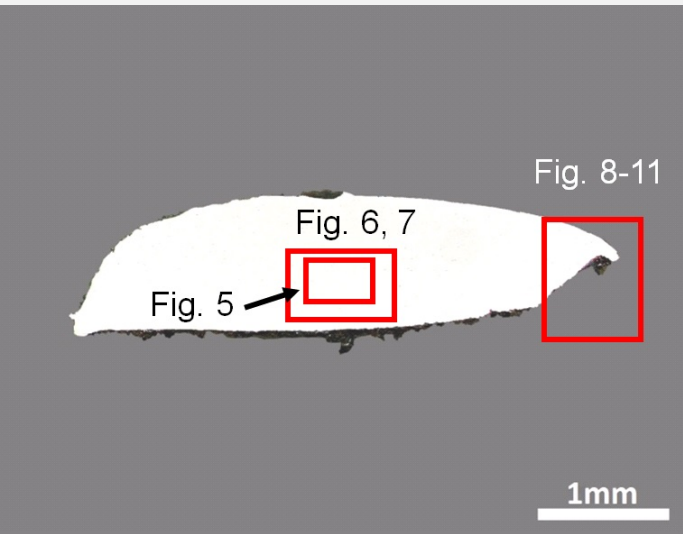

Credit HE-Arc CR.


Fig. 3: Micrograph of the cross-section of the sample taken from the back fastening plate showing the location of Figs. 5 to 11,

Description of sample


Sample cut from the corner of the fastening plate (Fig. 2). Dimensions: L = 4mm ; W = 1.2mm.

Alloy


Al Alloy

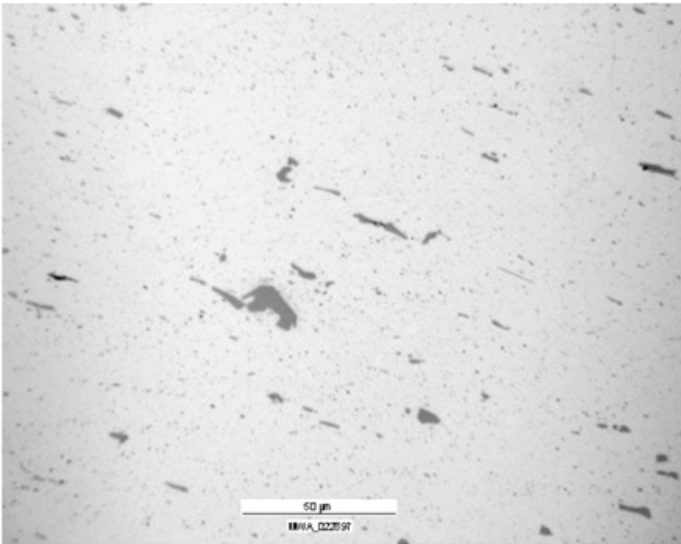

Credit HE-Arc CR.

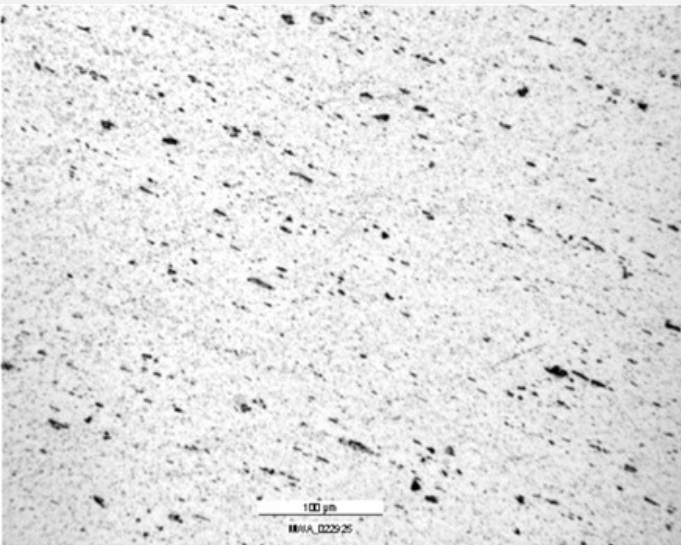

Credit HE-Arc CR.

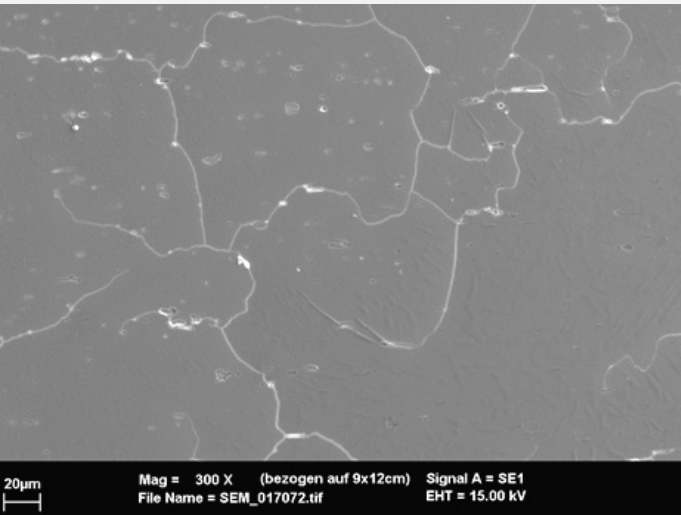

Credit HE-Arc CR.

Fig. 6: Micrograph of the metal sample from Fig. 3 (detail), etched, bright field. The metal matrix is in white, the elongated inclusions in dark-grey and black,


Fig. 7: SEM image of the metal sample from Fig. 3 (detail), SE-mode, etched. We observe the presence of large grains and numerous elongated inclusions,

Microstructure	Recrystallized structure with large grains
First metal element	Al
Other metal elements	Si

Nothing to report.


Corrosion layers

The metal is covered by a very thin corrosion layer (CP1). In addition to this, locally thicker adhering materials can be observed (NMM1, appearing as dark-grey area in Fig. 8). Under polarized light, they appear blue-brown (Fig. 9). Analysis by SEM-EDS indicates that the metal is, as expected, covered by a very thin Al and O-rich layer whereas the particles in the adherent material contain C, O, Si, Ca, Fe, Zn, S and even Ti (Figs. 10 and 11). The location of the adherent material and the presence of both Zn and Ti suggest that it is a residue of a paint coating.

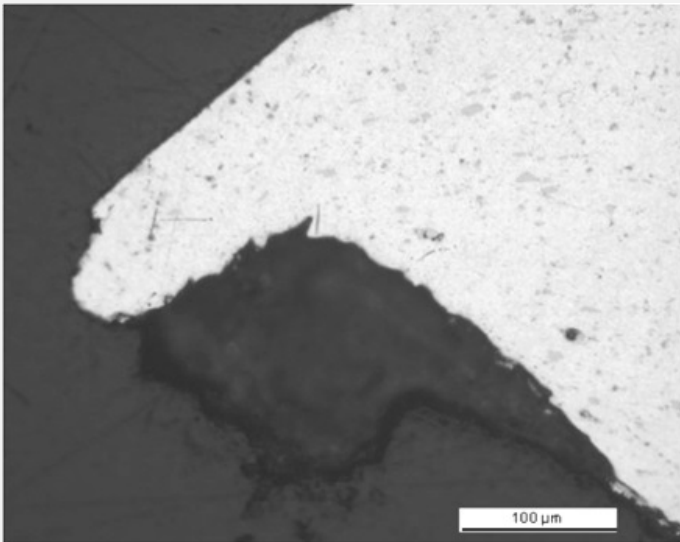

Credit HE-Arc CR.


Fig. 8: Micrograph showing the metal - adhering material interface from Fig. 3 (reversed picture, detail), unetched, bright field. We observe in white the metal matrix and dark-grey the adhering material,

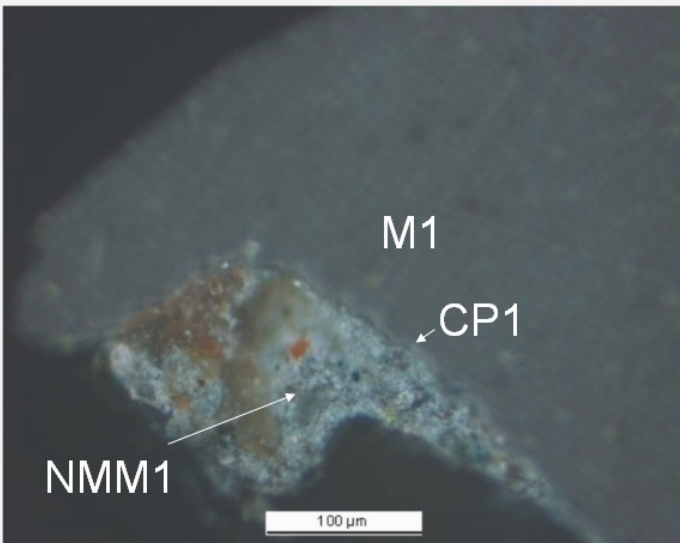


Credit HE-Arc CR.

Fig. 9: Micrograph (same as Fig. 8) and corresponding to the stratigraphy of Fig. 4, unetched, polarised light. We observe in grey the metal matrix and blue-brown the adhering material,

Fig. 10: SEM image (same as Fig. 8, inverted picture, detail), BSE-mode, unetched,

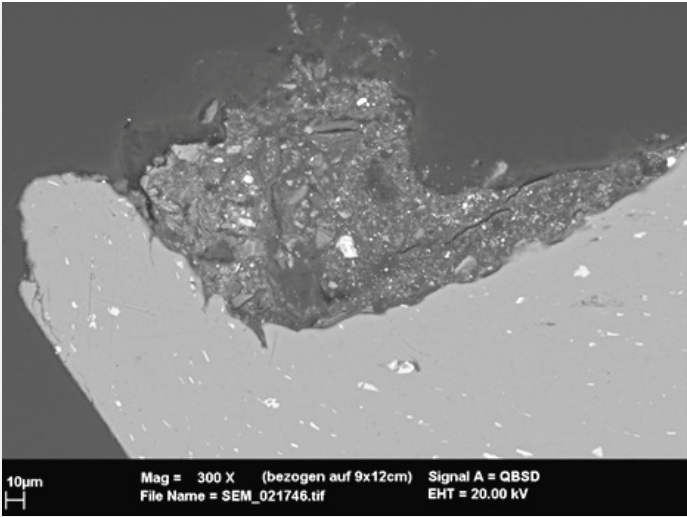

Credit HE-Arc CR.

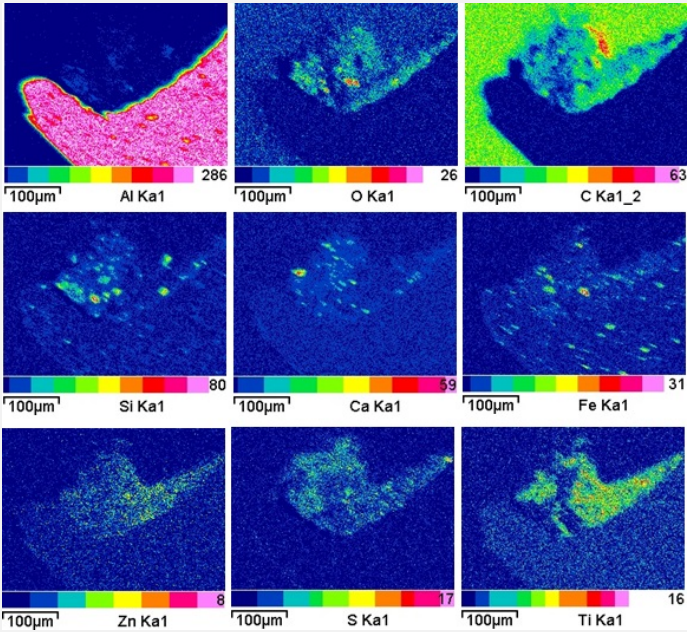

Credit HE-Arc CR.

Corrosion form Passive

Corrosion type None

Complementary information

Nothing to report.

⌵ MiCorr stratigraphy(ies) – CS

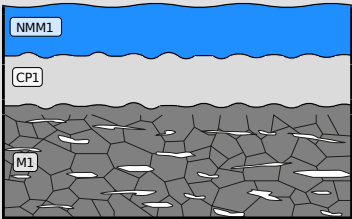


Fig. 11: Elemental chemical distribution of the selected area from Fig. 10. Method of examination: SEM/EDS, Laboratory of Analytical Chemistry, Empa,

Fig. 4: Stratigraphic representation of the sample taken from the back fastening plate in cross-section (dark field) using the MiCorr application. The characteristics of the strata are only accessible by clicking on the drawing that redirects you to the search tool by stratigraphy representation. This representation can be compared to Fig. 9, Credit HE-Arc CR.

✧ Synthesis of the binocular / cross-section examination of the corrosion structure

Corrected stratigraphic representation: none.

✧ Conclusion

This aluminium alloy has a composition similar to a primary aluminium with an Al content between 99 and 99.8 mass%. The main impurities are Si and Fe. Because of their insolubility in the aluminium they form intermetallic (alpha-AlFeSi) inclusions. The metal was hot rolled and annealed. It is covered by a very thin corrosion layer (probably aluminium oxide) and in some areas adherent materials are present, most likely the remains of a Zn- and Ti-rich paint system mixed with environmental pollutants.

✧ References

References on object and sample

References object

1. Rumo, L. (2008) Analyse et caractérisation des alliages constitutifs de l'avion Dufaux IV. Mémoire Filière conservation-restauration, Haute Ecole art appliqués, La Chaux-de-Fonds, 101-105.

References sample

2. Rumo, L. (2008) Analyse et caractérisation des alliages constitutifs de l'avion Dufaux IV. Mémoire Filière conservation-restauration, Haute école art appliqués, La Chaux-de-Fonds, 101-105.

References on analytic methods and interpretation