

ROOF GUTTER ELEMENT – ZN ALLOY – MODERN TIMES – FRANCE

Artefact name	Roof gutter element
Authors	Christian. Degriigny (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland) & Mathea. Hovind (University of Oslo, Department of archaeology, conservation and history (IAKH-UiO), Oslo, Oslo, Norway)
Url	/artefacts/880/

✖ The object

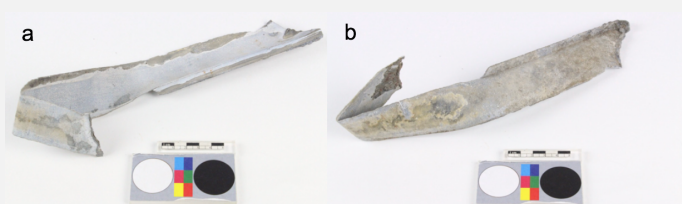


Fig. 1: Roof gutter element having different appearances on each of its surfaces: "a" on the left and "b" on the right,

Credit UiO-IAKH, M.Hovind.

✖ Description and visual observation

Description of the artefact	A roof gutter element with remains of lead solder (Fig. 1). Its surfaces are covered by a white, strongly adherent oxide layer. Surface "b" is slightly darker in colour than surface "a" due to the presence of soil particles. Dimensions: L = 265mm; W = 47mm; T = 1mm; WT = 93g.		
Type of artefact	Architectural element		
Origin	Château de Germolles, Mellecey, Bourgogne, France		
Recovering date	Unknown		
Chronology category	Modern Times		
chronology tpq	1900	A.D.	▼
chronology taq	2000	A.D.	▼
Chronology comment	19th-20th century		
Burial conditions / environment	Outdoor atmosphere		
Artefact location	HE-Arc CR, Neuchâtel, Neuchâtel		
Owner	Château de Germolles, Mellecey, Bourgogne		
Inv. number	None		
Recorded conservation data	N/A		

Complementary information

None.

Study area(s)



Credit UiO-IAKH, M.Hovind.

Fig. 2: Location of sampling area (a cross-section through the metal marked by the stippled line) and of powder samples (red circles),

Binocular observation and representation of the corrosion structure

The schematic representation below (Fig. 3) gives an overview of the corrosion layers encountered on the object from a first visual macroscopic observation.




Captions	Description
D1	Remains of lead solder.
S1	Light brown and porous soil. Located only on surface "b".
CP1	Light grey to white, thin and adherent layer. Located on both surfaces.
M1	Intact metal. Submetallic and light grey in colour.

Credit UiO-IAKH, M.Hovind.

Fig. 3: Schematic presentation of the artefact based on visual macroscopic observation. CP = corrosion product, D = deposit, M = metal, S = soil,

MiCorr stratigraphy(ies) – Bi

Sample(s)

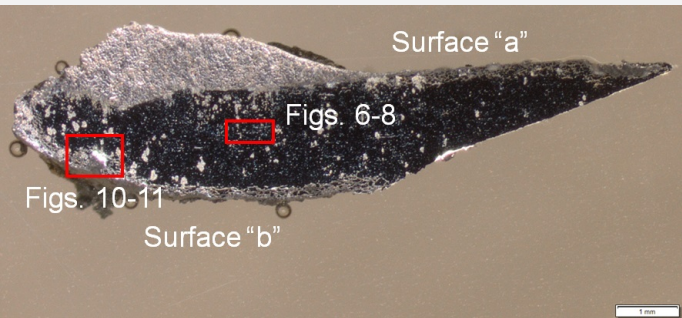

Credit UiO-IAKH, M.Hovind.

Fig. 4: Micrograph of the sample taken from the roof gutter showing the locations of Figs. 6-8 and 10-11. The uppermost area (in white) is remains of solder, while the zinc metal appears dark grey to black (the white patches are due to secondary oxidation of the sample),

Description of sample

A cross-section (Fig. 4) was cut out where the metal is at an angle of approximately 90° to the flat surface. Its upper edge corresponds to surface "a" and contains remains of solder, while the lower edge corresponds to surface "b".

Alloy	Zn Alloy
Technology	Annealed after (hot) rolling
Lab number of sample	ZG2018 (zinc gutter sampled in 2018)
Sample location	HE-Arc CR, Neuchâtel, Neuchâtel
Responsible institution	HE-Arc CR, Neuchâtel, Neuchâtel
Date and aim of sampling	March 2018, metallography and chemical analyses

Complementary information

The fact that the fragment was considered a test material enabled extensive sampling that would not otherwise be possible.

✧ Analyses and results

Analyses performed:

Metallography: microscope: Leica DMI8 (a metallographic, inverted, reflected light microscope) with magnification up to 500X. Camera: Olympus SC50 connected to the software "Olympus Stream", version 1.9.4. Illumination modes: bright field and cross-polarized light.

SEM-EDS: instrument: Jeol 6400; voltage: 20 kV; working distance: 18 and 24mm; sample preparation: palladium depot.

XRD: diffractometer system: XPERT-3; Sample stage: Reflection-Transmission Spinner PW3064/60; Anode material: Cu.

✧ Non invasive analysis

None.

✧ Metal


The roof gutter element is composed of Zn with P and Pb at lower concentrations (Fig. 5). The latter is probably originating from the solder that was applied to adjoin several metal sheets for the roof gutter.

The metal appears white to light grey under bright field (Fig. 6). Under polarized light however (Fig. 78), the microstructure of the metal is visible as small polygonal grains appearing in various shades of brown, a coloured effect due to the anisotropic properties of the metal (Scott 1991: 49). In the SEM-image, white elongated inclusions are visible (Fig. 8) consisting mainly of Zn and Pb with some O (Fig. 90).




Credit HEI Arc, C.Csefalvay.

Fig. 5: Chemical composition of the metal. Method of analysis: SEM-EDS. Lab. of Electronic Microscopy and Microanalysis, Néode, HEI Arc,

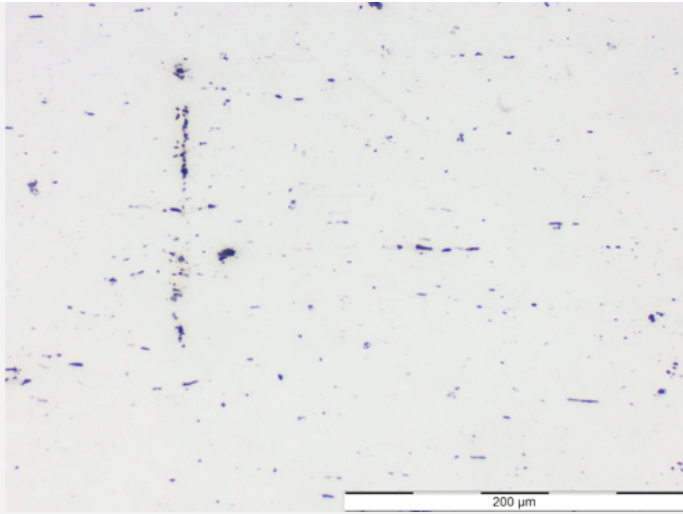


Credit UiO-IAKH, M.Hovind.

Fig. 6: Micrograph of the metal sample from Fig. 4 (detail). Unetched, bright field,

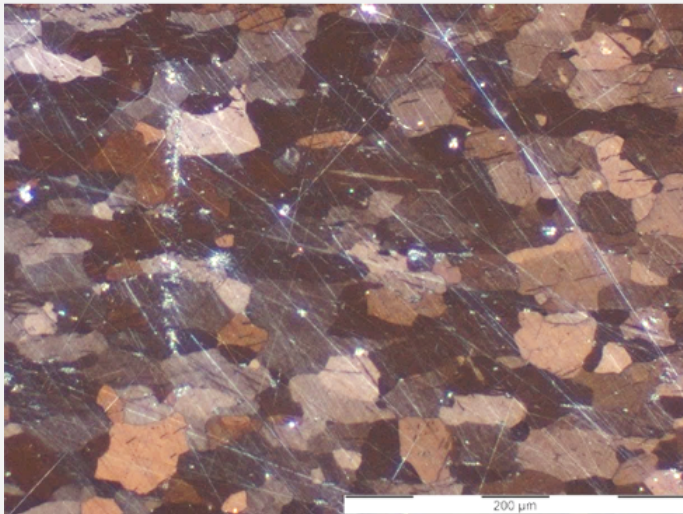

Credit UiO-IAKH, M.Hovind.

Fig. 7: Micrograph similar to Fig. 6, but under polarized light. The microstructure of the metal shows the presence of small and polygonal grains in shape,

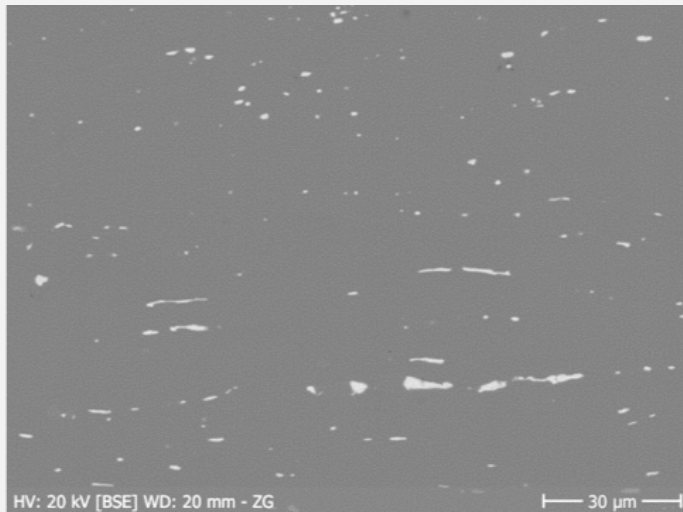

Credit HEI Arc, C.Csefalvay.

Fig. 8: SEM-image (BSE-mode) of the metal sample from Fig. 4 (detail) showing the white elongated inclusions,

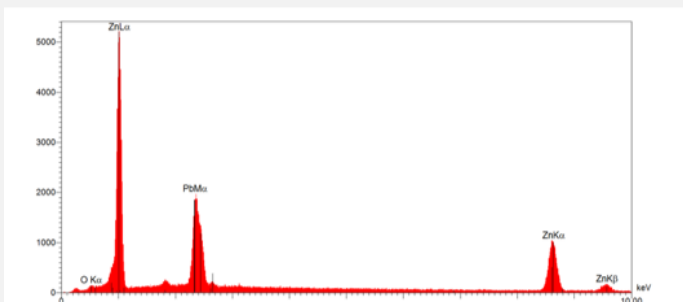


Fig. 9: SEM-EDS spectrum showing the composition of the elongated inclusions from Fig. 8. Method of analysis: SEM-EDS. Lab. of Electronic Microscopy and Microanalysis, Néode, HEI Arc,

Microstructure	Recrystallized structure (polygonal grains)
First metal element	Zn
Other metal elements	P, Pb

Complementary information

None.

Corrosion layers


The metal is suffering from intergranular corrosion visible as a white corrosion product (CP1) located within crevices and along the grain boundaries (Figs. 10 and 11). The porous and powdery corrosion product (CP1) appears dark grey in bright field (Fig. 10) and white-grey under polarized light (Fig. 11). It consists of Zn and O (Table 1). The external corrosion product (CP1) contains some S (and not Pb as suggested by Table 1 and Fig. 13) which is probably due to atmospheric pollution. The structural composition of the corrosion product was determined by crystallographic analysis (XRD) to consist of a mixture of zincite (ZnO) and pure zinc (Zn) (Table 2, Fig 12). Mapping of the corroded area by SEM-EDS displays a similar composition but shows additionally the presence of Cl in some of the veins of the corroded metal (Fig. 13). S1 (soil material) is found on the very top of CP1.

Layer	Elements mass %	C	O	Zn	Pb	S	Al	Si	Fe	Cu	Sn
CP1, white corrosion product		7	33	51	3	5	-	0.3	0.1	0.1	0.4
CM1, intergranular corrosion		6	22	68	3	0.1	0.1	0.1	0.1	0.1	0.5

Table 1: Chemical composition of the corrosion layers from Fig. 10. Method of analysis: SEM-EDS. Lab. of Electronic Microscopy and Microanalysis, Néode, HEI Arc, credit MiCorr_HEI Arc, C.Csefalvay. *The sum is the calculated average of three analyses of the same feature, but in different areas.


Stratum	Components*
CP1	Zincite (ZnO), Zinc (Zn)

Table 2: Summary of the results from the crystallographic analysis of the white corrosion product (CP1). A representative spectrum is given in Fig. 12. Method of analysis: XRD. Center of X-ray Analytics, Empa-Swiss Federal Laboratories for Materials Science and Technology (Dübendorf), credit MiCorr_Empa, Z.Balogh-Michels. *The results are based on the analysis of two powder samples from different areas (see Fig. 2 for sample locations).

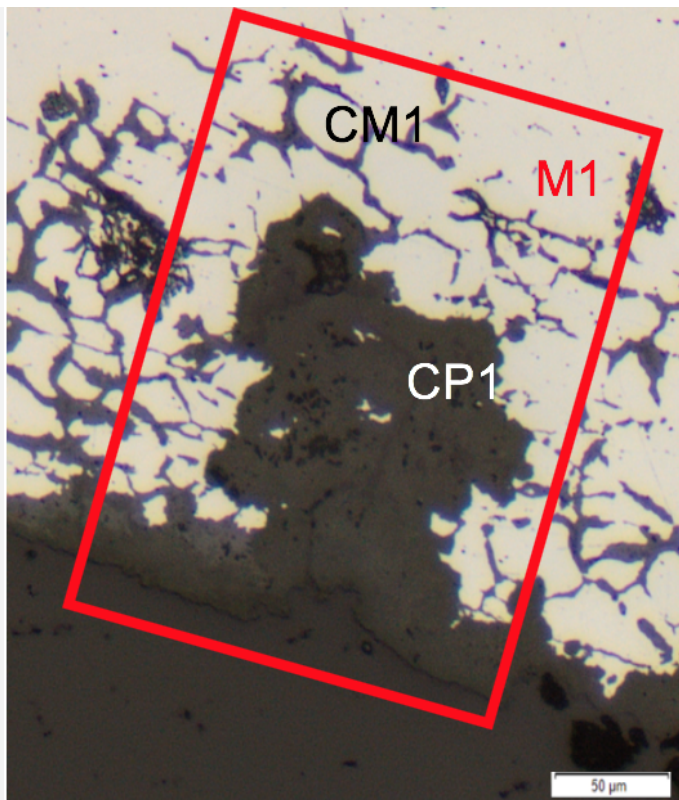

Credit UiO-IAKH, M.Hovind.

Fig. 10: Micrograph of the metal sample from Fig. 4 (detail). Unetched, bright field. The corrosion product (CP1) is located at the surface of the metal and in its crevices. Intergranular corrosion (CM1) is visible as thin grey lines in between the metal grains (M1). The corrosion structure is to compare to the stratigraphy representation of Fig. 14. The area selected for elemental chemical distribution (Fig. 13) is marked by a red rectangle,

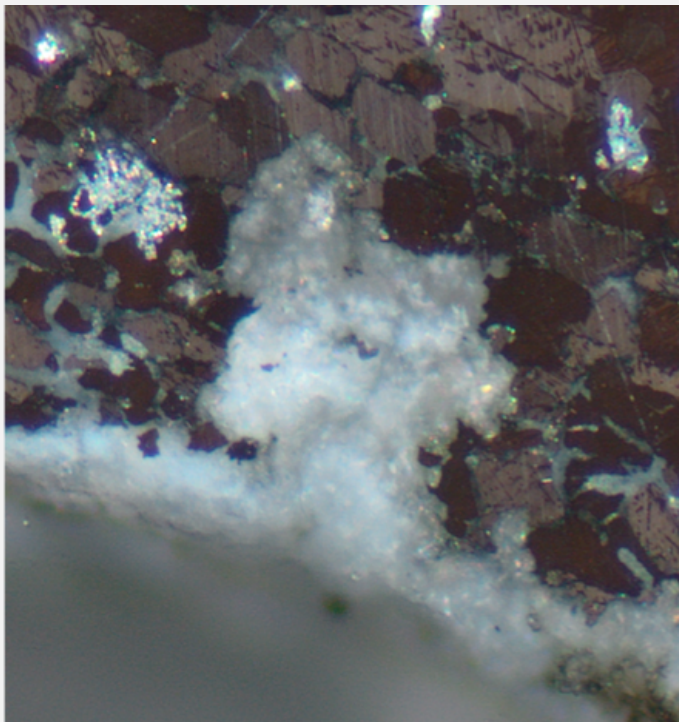

Credit UiO-IAKH, M.Hovind.

Fig. 11: Micrograph similar to Fig. 10 but under polarized light, the corrosion product (CP1) and the corroded metal (CM1) appear white,


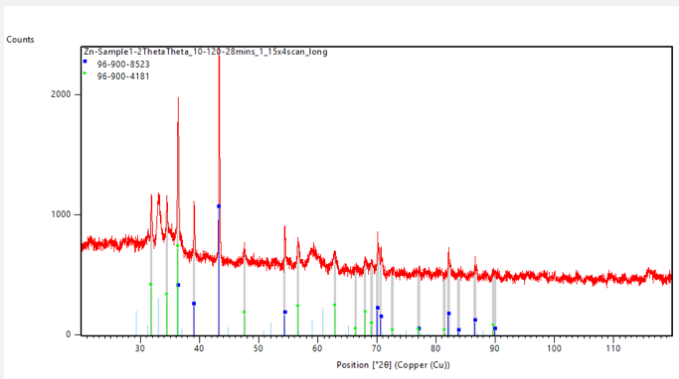


Fig. 12: XRD-spectrum for the analysis of powder sample 1. Ref. 96-900-8523 (in blue) corresponds to pure zinc and 96-900-4181 (in green) to zincite (ZnO),

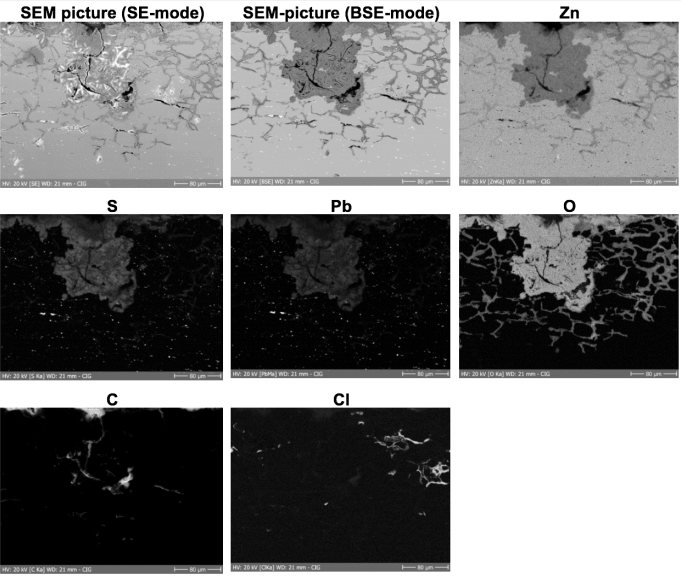

Credit HEI Arc, C.Csefalvay.

Fig. 13: SEM image and elemental chemical distribution of a selected area of Fig. 10 (rotated almost 180° and reversed). Method of analysis: SEM-EDS. Lab. of Electronic Microscopy and Microanalysis, Néode, HEI Arc,

Corrosion form	Multiform - intergranular
Corrosion type	Unknown

Complementary information

None.

✧ MiCorr stratigraphy(ies) – CS

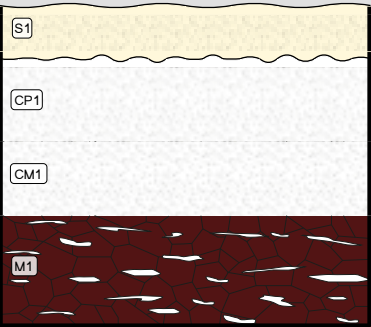


Fig. 14: Stratigraphic representation of the sample taken from the roof gutter (surface "b") in cross-section (dark field) using the MiCorr application. The characteristics of the strata are only accessible by clicking on the drawing that redirects you to the search tool by stratigraphy representation. This representation can be compared to Figs. 10 and 11, Credit UiO-IAKH, M.Hovind.

✧ Synthesis of the binocular / cross-section examination of the corrosion structure

The schematic representation of corrosion layers integrating additional information based on the analyses carried out is given in Fig. 15.



Credit UiO-IAKH, M.Hovind.

Fig. 15: Improved stratigraphic representation of the roof gutter element with results from analyses by SEM-EDS, XRD and visual microscopic observation. CP = corrosion product, D = deposit, M = metal, S = soil,

✧ Conclusion

The roof gutter element consists of Zn with some Pb from the lead solder. It is covered by a strongly adherent layer of zincite (a zinc oxide), indicative of exposure to an unpolluted environment. Still, the metal exhibits intergranular corrosion, a deterioration phenomenon indicative of aggressive conditions. This can possibly be explained by the different locations of the samples. The cross-section studied is likely to correspond to the surface that was exposed to the atmosphere (surface "b"), while the powder samples were from the rear, unexposed surface (surface "a"). Exposure to moisture and low pH in the form of acidic rain are environmental parameters that would encourage intergranular corrosion. Furthermore, the presence of Cl inside the cracks could be due to pollution and its rather concealed location implies that it would be retained inside the metal and not washed away by rain (Selwyn 2004:153-154).

✧ References

References on object and sample

References sample

1. Scott, D. A. (1991) Metallography and microstructure of ancient and historic metals. Marina del Rey, Calif.: Getty Conservation Institute in association with Archetype Books.
2. Selwyn, L. (2004) Metals and corrosion: A handbook for the conservation professional. Ottawa: Canadian Conservation Institute.