



# SHINGLE OF A ROOF - CU ALLOY - MODERN TIMES - SWITZERLAND

Artefact name Shingle of a roof

**Authors** Marianne. Senn (EMPA, Dübendorf, Zurich, Switzerland) & Christian. Degrigny (HE-Arc CR, Neuchâtel,

Neuchâtel, Switzerland)

Url /artefacts/892/

## ▼ The object

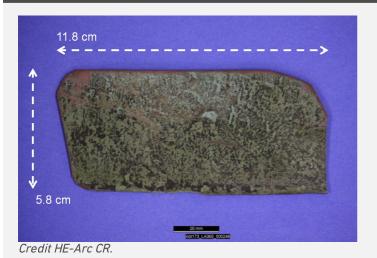


Fig. 1: Shingle of a roof, internal side,

# ▼ Description and visual observation

**Description of the artefact** Shingle, slightly curved, the internal side is covered with heterogeneously distributed green

and black corrosion products (Fig. 1). The external side shows a regular dark green corrosion

crust. Dimensions: L = 11.8cm; W = 5.8cm.

Type of artefact Architectural element

Origin Roof of the Abbey of St Gallen, Sankt Gallen, Saint Gallen, Switzerland

Recovering date None

**Chronology category** Modern Times

chronology tpq 1780 A.D. ∨

chronology taq

**Chronology comment** 

Burial conditions / environment

Outdoor atmosphere

**Artefact location** 

Conservation Department of the Musées d'art et d'histoire, Genève, Geneva

**Owner** 

Abbey of St Gallen, Sankt Gallen, Saint Gallen

Inv. number

None

N/A

Recorded conservation data

Complementary information

None.

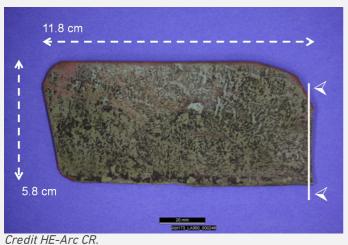


Fig. 2: Location of sampling area,


orean rie rire ort.

▼ Binocular observation and representation of the corrosion structure

None.

★ MiCorr stratigraphy(ies) – Bi

Fig. 3: Micrograph of the cross-sections of the sample taken from the shingle showing the location of Figs. 4 to 7,

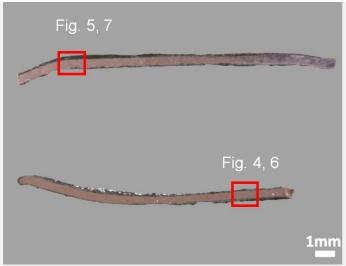

Credit HE-Arc CR.

Description of sample Two samples were taken (Fig. 3). The polished samples show a well-preserved metal surface

with a thin corrosion crust, T = 0.5mm.

Alloy Cu Alloy

Rolled (probably hot rolling) and annealed **Technology** 

Lab number of sample MAH-98-257

Sample location HE-Arc CR (Degrigny Christian), Neuchâtel, Neuchâtel

Responsible institution Conservation Department of the Musées d'art et d'histoire, Genève, Geneva

Date and aim of sampling 2009, integration of sample to the MIFAC-Metal project (Degrigny, 2016)

# Complementary information

None.

# ★ Analyses and results

# Analyses performed:

Metallography (etched with ferric chloride reagent), Vickers hardness testing, LA-ICP-MS, SEM/EDS, XRD, Raman spectroscopy.

None.





The remaining metal is a copper alloy (Table 1). The evenly distributed inclusions observed under SEM, SE-mode, are either light-grey or white (Fig. 4). The oval shape of the light-grey inclusions is due to deformation, probably by hot rolling (a common technique in the 18th century). Under polarised light they look red (Fig. 6) and their analysis reveals a composition similar to cuprite/Cu20 (Table 2). The white inclusions are rich in Pb and are remnants of the refining process (Table 2). The etched copper shows a structure of polygonal and twinned grains (Fig. 5). The grain size is variable. The average hardness of the metal is about HV1 70.

Elements	Cu	Pb	As	Sb	Ag	Bi	Sn	Zn	Ni	Fe	Со
mass%	99	0.7	0.1	0.1	0.05	<	<	<	<	<	<
RSD %	0.3	25	20	7	4						

Table 1: Chemical composition of the metal. Method of analysis: LA-ICP-MS, Laboratory of Basic Aspects of Analytical Chemistry at the Faculty of Chemistry, University of Warsaw, PL.

Elements	0	Cu	Pb	As	Sb	Total
Light-grey inclusion	9.8	86	<	<	<	96
White inclusion	9	9.1	68	5.1	2.6	94

Table 2: Chemical composition (mass %) of the inclusions in the metal (from Fig. 4). Method of analysis: SEM/EDS, Laboratory of Analytical Chemistry, Empa.

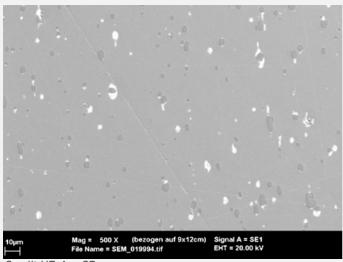


Fig. 4: SEM image, SE-mode, of the metal sample from Fig. 3 (detail). Light-grey and white inclusions are distributed evenly,

Credit HE-Arc CR.

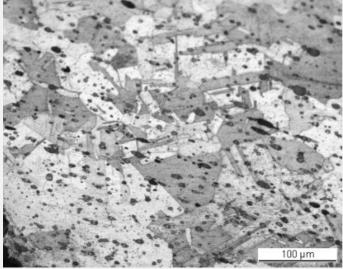


Fig. 5: Micrograph of the metal sample from Fig. 3 (detail), etched, bright field. The metal shows a structure of polygonal and twinned grains. Cuprite inclusions appear as dark spots,

Credit HE-Arc CR.

P.4/7

Microstructure Polygonal and twinned grains, elongated inclusions

First metal element Cu

Other metal elements Pb

### **Complementary information**


None.

#### ♥ Corrosion layers

The corrosion crusts of the external and internal sides are distinctively different (Fig. 6). On the internal side an irregular reddish-orange corrosion layer has developed, and pitting corrosion has occurred. The more uniform corrosion layers on the external side consist of a reddish-orange layer, with a thicker green layer above. In some areas, dark-red corrosion products can be observed between the green and reddish-orange sub-layers. The same dark-red sub-layer can be seen in areas on the internal side covering the reddish-orange corrosion products. The reddish-orange corrosion layer on both sides (CP2) has a chemical composition similar to cuprite/Cu2O, while the green layer on the external side (CP1) contains Cu, S and O and is enriched on its upper surface with Si (Table 3 and Fig. 7). XRD analysis of the corrosion products on the external side of another shingle fragment from the same roof identified brochantite/ $Cu_4SO_4(OH)_6$  and cuprite as corrosion products (Rapport d'analyse no. MAH 98-257). These results are confirmed by Raman spectroscopy of the external side of this sample where the same compounds were clearly identified (Figs. 8 and 9).

Elements	0	Cu	S	Total
CP1	20	59	6.2	85
CP2	11	86	<	97


Table 3: Chemical composition (mass %) of the corrosion layers of the external side. Method of analysis: SEM/EDS, Laboratory of Analytical Chemistry, Empa.

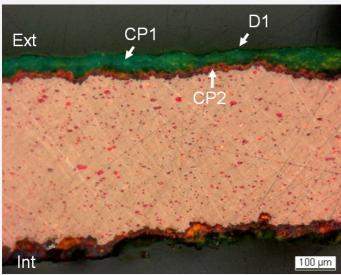

Credit HE-Arc CR.

Fig. 6: Micrograph of the metal sample from Fig. 3 and corresponding to the stratigraphy of Fig. 10, polarised light. External side: the regular corrosion crust with outer green, inner red-orange corrosion products and intermediate darkred corrosion products. Internal side: the irregular corrosion crust with inner red-orange and outer dark-red corrosion products.

Fig. 7: SEM image, SE-mode, and elemental chemical distribution of a selected area on the external side (rotated image, detail of Fig. 3). Method of examination: SEM/EDS, Laboratory of Analytical Chemistry, Empa,

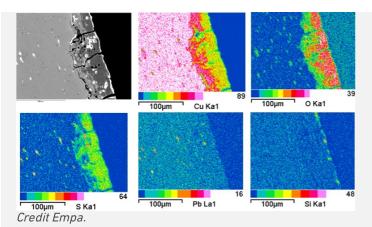

20000 16000 12000 12000 8000 -cat 3 B 8000 --- cuprite standard 4000 100 500 Raman shift (cm-1)

Fig. 8: Raman spectrum of the red-orange inner corrosion layer (CP2) of the external side (cat3\_B) compared to a cuprite standard spectrum. Settings: laser wavelength 532nm, acquisition time 100s, one accumulation, filter D2 (0.75-0.8 mW), hole 500, slit 80, grating 600. Method of analysis: Raman spectroscopy, Lab Swiss National Museum, Affoltern a. Albis ZH,

Credit SNM.

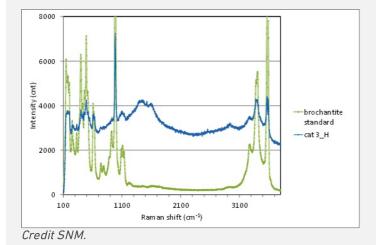


Fig. 9: Raman spectrum of the green outer corrosion layer (CP1) of the external side (cat3\_H) compared to a brochantite standard spectrum. Settings: laser wavelength 532nm, acquisition time 100s, one accumulation, filter D2 (0.75-0.8 mW), hole 500, slit 80, grating 600. The peak indicated with an arrow on the cat3\_H spectrum is due to fluorescence. Method of analysis: Raman spectroscopy, Lab Swiss National Museum, Affoltern a. Albis ZH,

Corrosion form Uniform - pitting

**Corrosion type** Type I (Robbiola)

### Complementary information

None.

# 

Fig. 10: Stratigraphic representation of the sample taken from the shingle in cross-section (dark field) using the MiCorr

application. The characteristics of the strata are only accessible by clicking on the drawing that redirects you to the search tool by stratigraphy representation. This representation can be compared to Fig. 6, Credit HE-Arc CR.

₩ 5	Synthesis of the	binocular /	cross-section (	examination of	the corrosion	structure
-----	------------------	-------------	-----------------	----------------	---------------	-----------

None.

#### ♥ Conclusion

The copper shingle was rolled (probably hot rolling) and annealed to recover the ductility of the original material. The metal is covered on its external side by a typical "urban outdoor" patina consisting of copper sulphate (brochantite/Cu4(OH)6SO4) formed on top of a cuprite/Cu2O layer. The surface of the internal side, protected from the dilute sulphuric acid present in urban rainwater, has mainly developed a layer of cuprite. The silica present in the brochantite on the external side is due to airborne particle pollution. The corrosion is probably of type 1 after Robbiola et al. 1998.

#### ▼ References

# References on object and sample

1. Rapport d'analyse n° MAH 98-257. Laboratoire Musées d'art et d'histoire, Genève. The report describes a sample from another shingle.

#### References on analytic methods and interpretation

- 2. Robbiola, L., Blengino, J-M., Fiaud, C. (1998) Morphology and mechanisms of formation of natural patinas on archaeological Cu-Sn alloys, Corrosion Science, 40, 12, 2083-2111.
- 3. Selwyn, L. (2004) Metals and Corrosion: A Handbook for the Conservation Professional, Ottawa, ON: Canadian Conservation Institute, 68-70.
- 4. Stöckle, B., Mach, M. and Krätschmer, A. (1997) La durabilité des couvertures en cuivre selon les conditions environnementales. Résultat de l'UN/ECE-Programme d'exposition climatique, Les couvertures métalliques, matériaux et techniques, Les cahiers de la section française de l'ICOMOS, Paris, 129-135.
- 5. Welter, J-M. (2007) La couverture en cuivre en France: une promenade à travers les siècles, Le métal dans l'architecture, Monumental, 104-112.
- 6. Degrigny, C. et al. (2016) Developing a decision support system for local diagnosis of heritage metals, in Metal16, proceedings of the ICOM-CC Metal WG interim meeting, eds. R. Menon, C. Chemello and A. Pandya, New Dehli, (India), 220-227.

