

MILITARY ID TAG 5668-MXX-1008-1 - ZN PB ALLOY - MODERN TIMES - FRANCE

Artefact name Military ID tag 5668-MXX-1008-1

Authors Christian. Degryny (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland) & Marie-Jeanne. Scholl (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland) & Valentin. Boissonnas (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland)

Url /artefacts/213/

✦ The object



Fig. 1: German military ID tag from First World War, recto and verso, 2013,

Credit HE-Arc CR, M-J.Scholl.

✦ Description and visual observation

Description of the artefact Fragments from an oval shaped plate with two circular holes at the central upper edge. Information concerning the soldier were given in the centre of the plate. The plate is covered with sediments. Dimensions (70 x 50 mm initially): L = 65mm; W = 50mm; T = 1 mm; WT = 6.3g.

Type of artefact Military tag

Origin German army, 94th Infantry Regiment, 1918, Carspach, Alsace, France

Recovering date Recovered in 2011

Chronology category Modern Times

chronology tqp A.D. ▾

chronology taq ---- ▾

Chronology comment 1915

Burial conditions / environment Soil

Artefact location Pôle d'Archéologie Interdépartemental Rhénan, Sélestat, Alsace

Owner Pôle d'Archéologie Interdépartemental Rhénan, Sélestat, Alsace

Inv. number 5668-MXX-1008-1

Recorded conservation data Not conserved

Complementary information

This 1915 model is the oldest standardized model (Directive 594 of the Ministry of War referenced 1085/7.15.B3). Burial conditions (loess sediments, collapsed shelter (Killianstollen) in March 1918 after a French bombing buried the tag at a depth between 3.5 and 6 meters).

Study area(s)




Credit HE-Arc CR, M-J.Scholl.

Fig. 2: Location of sample,

Binocular observation and representation of the corrosion structure

The schematic representation below gives an overview of the corrosion layers encountered on the military tag from a first visual macroscopic observation.

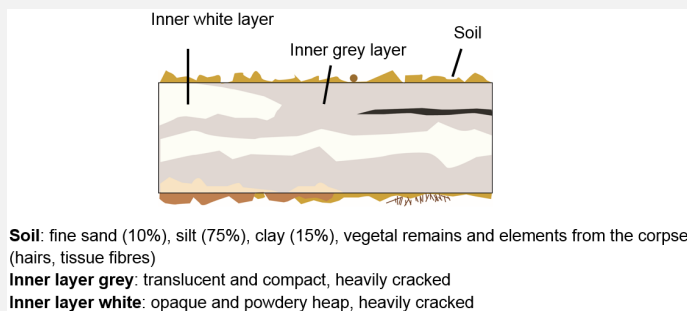

Credit HE-Arc CR, M-J.Scholl.

Fig. 3: Stratigraphic representation of the military tag in cross-section by macroscopic observation,

MiCorr stratigraphy(ies) – Bi

Sample(s)

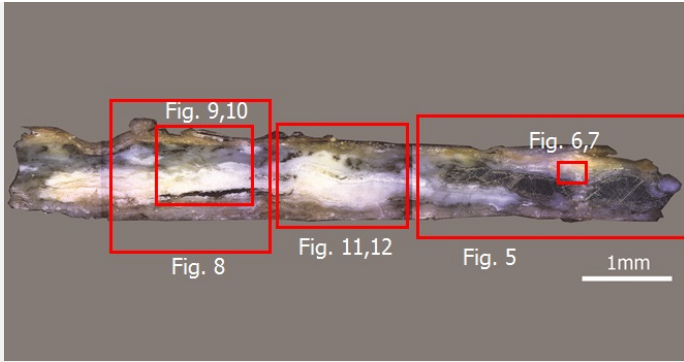


Fig. 4: Micrograph of the cross-section showing the locations of Figures 5-12. Unetched, dark field, 50x,

Credit HE-Arc CR.

| | |
|---------------------------------|--|
| Description of sample | This sample was cut out of fragment b in Fig. 1. The cross-section shows the entire thickness of the plate (L = 8 mm, W= 1 mm). The corrosion goes through the whole metal thickness but a metallic core remains (Fig. 4). |
| Alloy | Zn Pb Alloy |
| Technology | Cold worked (laminated) |
| Lab number of sample | - |
| Sample location | HE-Arc CR, Neuchâtel, Neuchâtel |
| Responsible institution | Pôle d'Archéologie Interdépartemental Rhénan, Sélestat, Alsace |
| Date and aim of sampling | 2013, metallography and chemical analyses |

∨ Analyses and results

Analyses performed:

Metallography (etched with HCl 10 M reagent), XRF, SEM/EDX, FTIR and Raman spectroscopy.

∨ Non invasive analysis

∨ Metal

The remaining metal is an almost pure zinc alloy (Table 1) containing 1.8% in weight lead. Lead appears in the metal in the form of small flattened white Pb inclusions (Figs. 5 and 6), confirming the manufacturing technique, namely lamination. The etched metal does not show any specific microstructure (Fig. 7).

| Elements | Zn | Pb |
|----------|------|-----|
| mass% | 98.2 | 1.8 |

Table 1: Chemical composition of the metal. Method of analysis: SEM-EDX, Lab of Electronic Microscopy and Microanalysis, IMA (Néode), HEI Arc.

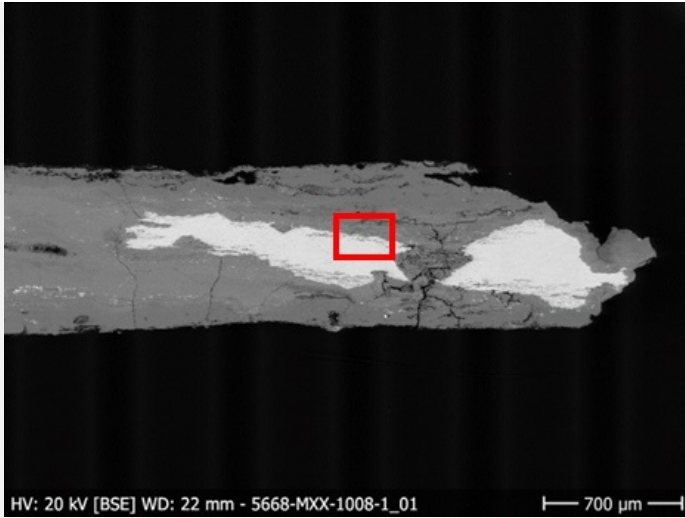


Fig. 5: SEM image of the cross-section, from Fig. 4 (detail), BSD-mode. Note the presence of Pb inclusions all through the thickness of the heavily cracked corrosion layers,

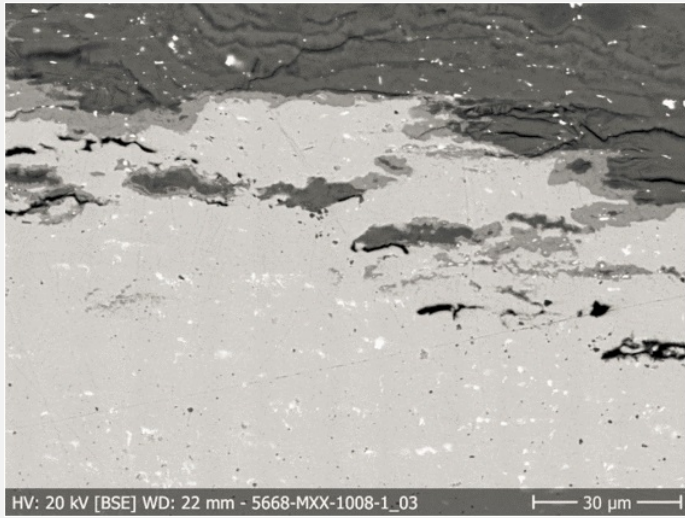


Fig. 6: SEM image of the cross-section, from Fig. 5 (detail), BSD-mode,

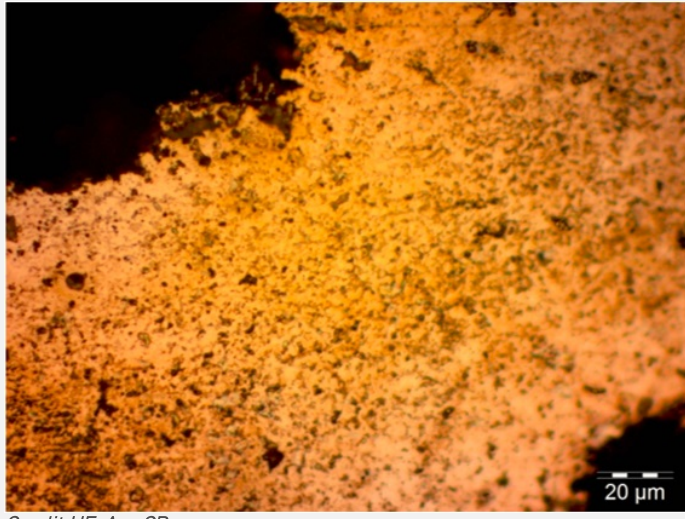


Fig. 7: Micrograph of the cross-section, etched, bright field, 500x,

| | |
|----------------------|----|
| Microstructure | ? |
| First metal element | Zn |
| Other metal elements | Pb |

∨ Corrosion layers

The corrosion spreads on the entire thickness of the plate and different forms of corrosion within the same plate may occur (multiform corrosion). Sometimes the metal core still remains, sometimes not.

The corrosion structure is multi-layered: several corrosion products overlap. However they are not all continuous layers, since some of them are isolated. Most of the corrosion products layers show structural voids (up to 100 µm thick) and some cracks inside. Three layers can be distinguished (Fig. 8) which have the same elements but in different proportions (Figs. 9, 10 and table 2):


- **Inner grey layer – CP2** (up to 1 mm thick) is a translucent, compact layer and constitutes most part of the corrosion products. Corroded metal appears inside this layer as lead inclusions within a black corrosion product (Figs. 11 and 12). Sulphur has also been detected by SEM-EDX inside this layer, near the surface, where the colour turns into grey-orange (zinc sulfide or sulphates but to be confirmed, table 2).
- **Inner white layer – CP1** (up to 0.6 mm thick) is an opaque and powdery heap, occurring in different places inside inner grey layer and sometimes near the surface, as pitting corrosion. The interface between inner layers grey and white is diffuse. Localized aggregates showing a crystalline microstructure of thickness of 50 µm are located against the walls of a structural void, inside the white corrosion product (Fig. 12).
- **Inner black layer – CP3** (up to 0.1 mm) is an opaque and compact layer with a composition similar to inner white layer (Table 2).

On top the metal is covered with non-metallic materials (fine sand (10%), silt (75%), clay (15%), vegetal remains) and elements from the corpse (hairs, tissue fibers)). An outer corrosion product has not been identified, but may occur, because zinc combined with sulphur was detected at the surface (Table 2).

The inner grey layer has been identified by FTIR as a zinc carbonate (smithsonite), mixed with other unidentified corrosion products. Raman spectra seems to confirm it (Fig. 13). The exact composition of inner white layer is unknown. Inner white layer shows a bluish fluorescence under UV light and has been identified by FTIR as a mixture of zinc oxides and carbonates, that could be zinc hydroxycarbonates (hydrozincite). Raman spectroscopy shows also a mixture of carbonates and other corrosion products (Fig. 14). The inner black layer is a zinc carbonate as well, identified by FTIR and Raman spectroscopy (Fig. 15) appearing as a vein between layers grey and white (Fig. 8).

| Elements | O | Zn | Pb | S |
|-------------------------|----|-----|-----|----|
| Inner grey layer (CP2) | ++ | +++ | + | |
| Black inclusions | | + | +++ | |
| Inner white layer (CP1) | ++ | +++ | + | |
| Inner black layer (CP3) | ++ | +++ | + | |
| Inner grey-orange layer | + | ++ | | ++ |
| Remnant metal phase | | +++ | + | |

Table 2: Chemical composition of the different corrosion layers from Fig. 11. Method of analysis: SEM-EDX, Lab of Electronic Microscopy and Microanalysis, IMA (Néode) (+++: high concentration, ++ medium concentration, + low concentration, nd: not-detected).

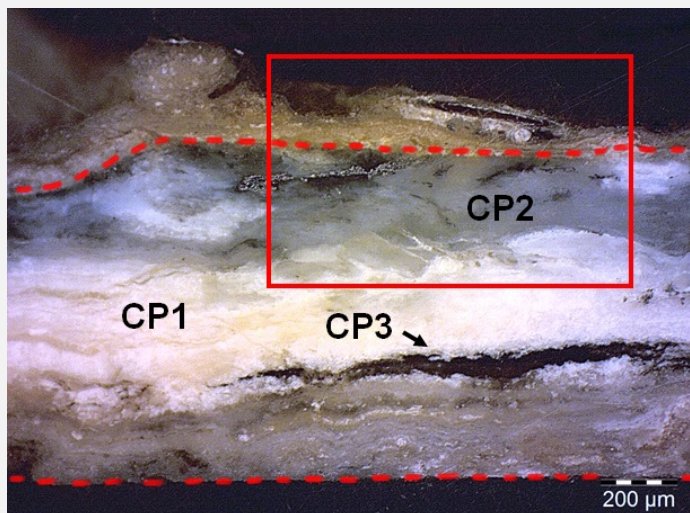


Credit HE-Arc CR.

Fig. 8: Micrograph of the cross-section, from Fig. 4 (detail), unetched, dark field, 50x. View of the inner layers and the limit of the original surface (red line). We can see that the interfaces between the different layers are not well defined: some of the white corrosion product is found inside the inner grey layer. The micrograph of Fig. 9 is marked by a rectangular,




Credit HEI Arc, S.Ramseyer.

Fig. 9: SEM image of the cross-section from Fig. 8 (detail), BSD-mode. The mapped area (Fig. 10) is marked by a rectangle,

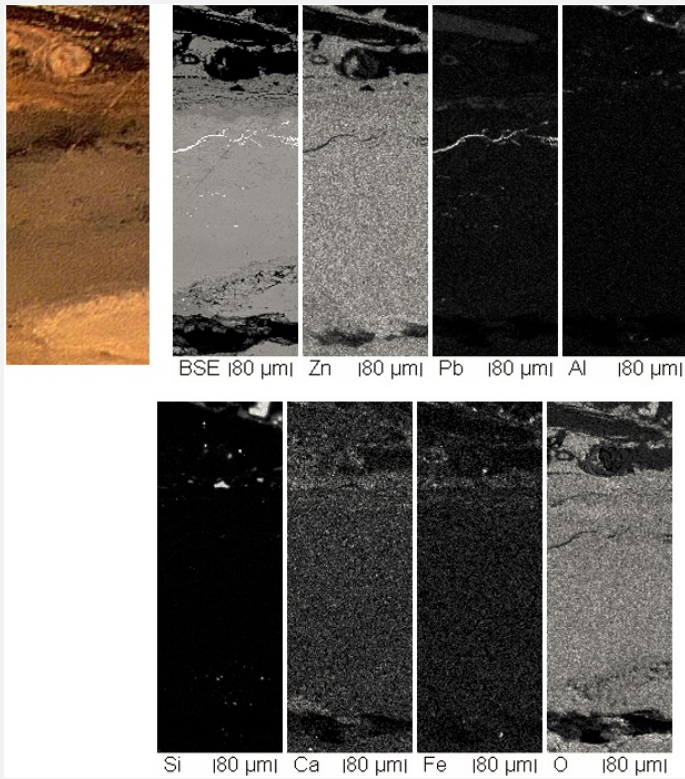

Credit HEI Arc, S.Ramseyer.

Fig. 10: SEM image of the cross-section from Fig. 9 (detail), SE-mode, and elemental chemical distribution. Method of examination: SEM/EDX, Lab of Electronic Microscopy and microanalysis, IMA (Néode), HEI Arc,

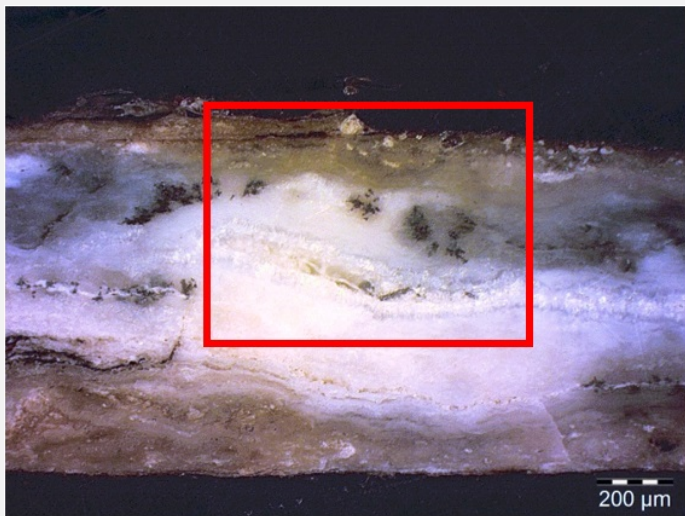

Credit HE-Arc CR.

Fig. 11: Micrograph of the cross-section, from Fig. 4 (detail), unetched, dark field, 50x. The micrograph of Fig. 12 is marked by a rectangular,

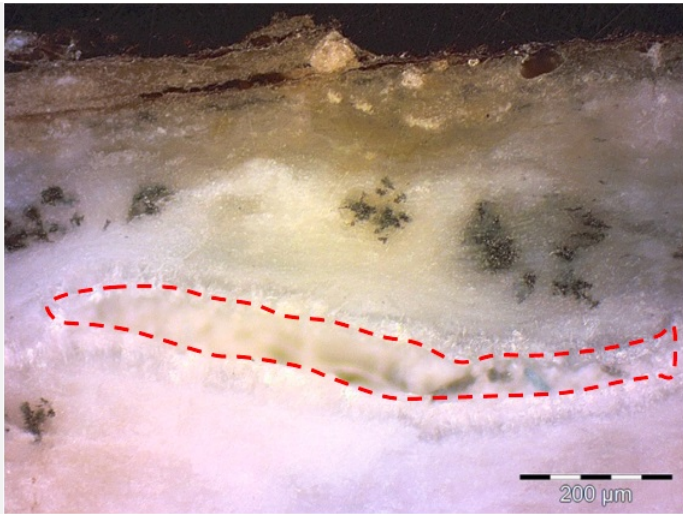


Fig. 12: Micrograph of the cross-section, from Fig. 9 (detail) unetched, dark field, 100x. Structural void (dotted red line) with aggregates,

Credit HE-Arc CR.

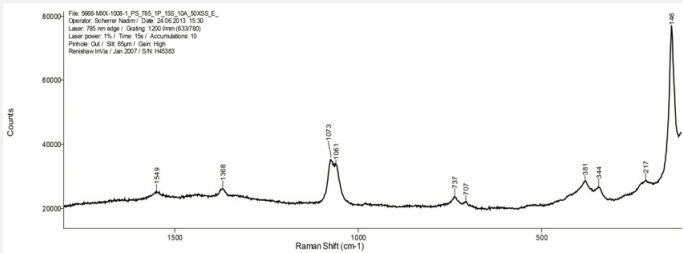


Fig. 13: Raman spectrum of inner grey layer (ZnCO₃ – smithsonite?). Settings: laser wavelength 532nm, acquisition time 10s, one accumulation, filter D2 (0.75-0.8mW), hole 500, slit 80, grating 600. Method of analysis: Raman spectroscopy, Art Technological Laboratory, Departement Conservation HKB,

Credit HE-Arc CR.

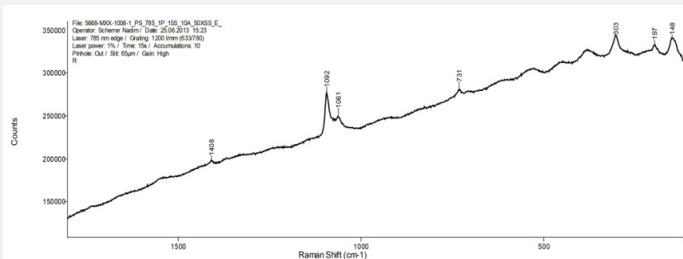


Fig. 14: Raman spectrum of inner white layer (zinc hydroxycarbonate?). Settings: laser wavelength 532nm, acquisition time 10s, one accumulation, filter D2 (0.75-0.8mW), hole 500, slit 80, grating 600. Method of analysis: Raman spectroscopy, Art Technological Laboratory, Departement Conservation HKB,

Credit HE-Arc CR.

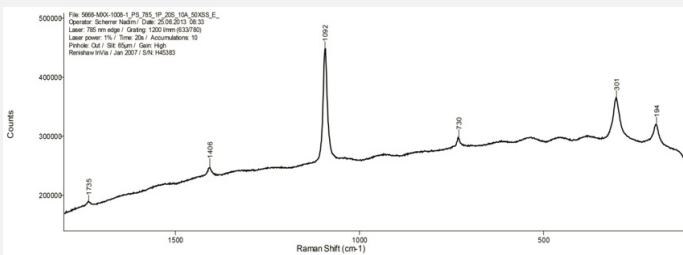


Fig. 15: Raman spectrum of inner black layer (zinc carbonate?). Settings: laser wavelength 532nm, acquisition time 10s, one accumulation, filter D2 (0.75-0.8mW), hole 500, slit 80, grating 600. Method of analysis: Raman spectroscopy, Art Technological Laboratory, Departement Conservation HKB,

Credit HE-Arc CR.

Corrosion form Multiform - transgranular

Corrosion type ?

✧ MiCorr stratigraphy(ies) – CS

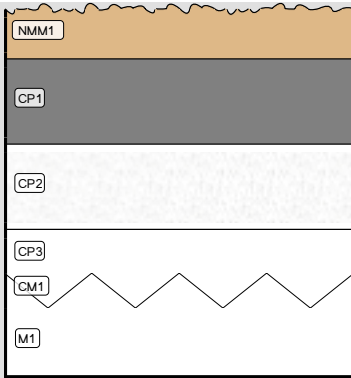


Fig. 5: Stratigraphic representation of the object in cross-section using the MiCorr application. This representation can be compared to Fig. 10.

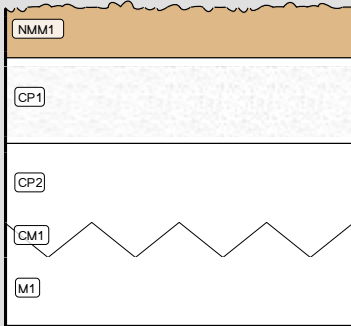


Fig. 6: Stratigraphic representation of the object in cross-section using the MiCorr application. This representation is different from Fig. 10 due to the inversion of CP1 and CP2. Furthermore, CP3 is not represented.

✧ Synthesis of the binocular / cross-section examination of the corrosion structure

Based on the analyses carried out, the schematic representation of the stratigraphy of the military tag has been corrected.

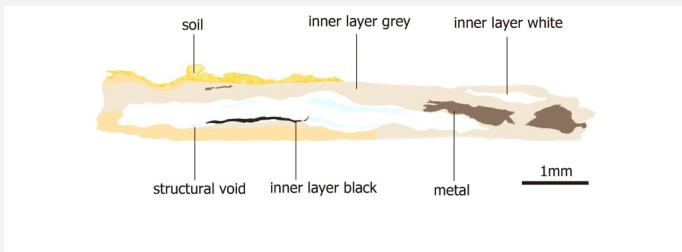


Fig. 16: Improved stratigraphic representation of the stratigraphy of corrosion layers on the military tag from visual observations and analyses,

| Strate | Composition |
|-------------------------------|---------------------------------------|
| Soil (S) | Elements from soil, organic elements |
| Grey corrosion product (CP1) | Zinc carbonate (smithsonite) + S |
| White corrosion product (CP2) | Zinc hydroxycarbonate + mixture of CP |
| Black corrosion product (CP3) | Zinc carbonate |
| Corroded metal (CM) | |
| Metal (M) | Zn-Pb |

Credit HE-Arc CR, M-J.Scholl.

✧ Conclusion

The military tag is made of a laminated sheet of zinc-lead alloy. The corrosion has entirely penetrated the objet leaving though some spots of remaining original metal inside the corrosion products. Lead particles are not affected by the corrosion process. The main corrosion products are zinc carbonates (smithsonite) and hydroxycarbonates (hydrozincite) but mixtures of different corrosion products can occur. These corrosion products are intermixed and heavily cracked.

✧ References

References on object and sample

Reference object

1. Scholl, M.-J. (2013) Caractérisation des plaques d'identification militaires en zinc provenant du site de Carspach (Alsace, Haut-Rhin, F). Travail de Bachelor Filière Conservation-restauration, Haute Ecole Arc de Conservation-restauration, Neuchâtel.

Reference sample

2. Scholl, M.-J. (2013) Caractérisation des plaques d'identification militaires en zinc provenant du site de Carspach (Alsace, Haut-Rhin, F). Travail de Bachelor Filière Conservation-restauration, Haute Ecole Arc de Conservation-restauration, Neuchâtel.

References on analytic methods and interpretation

3. Moser, Z., et al. (1994) The Pb-Zn (Lead-Zinc) System. In Journal of Phase Equilibria, vol.15, n°6, p.643-644.

4. Goodwin, F. E. (2010) "Corrosion of Zinc and its Alloys". In Cottis, R. A. Shreir's corrosion. vol.3 Corrosion and degradation of engineering materials. Elsevier Science, Oxford, 2078-2093.

5. De Zoubov, N. et Pourbaix, M. (1963) « Zinc », In Pourbaix, Marcel. Atlas d'équilibres électrochimiques. Gauthier-Villars, Paris, 406-413.