

WEDGE PART OF AN ALTAR CROWN SUSPENSION – P-RICH IRON AND HYPOEUTECTOID STEEL – MODERN TIMES – SWITZERLAND

Artefact name	Wedge part of an altar crown suspension
Authors	Marianne. Senn (EMPA, Dübendorf, Zurich, Switzerland) & Christian. Degriigny (HE-Arc CR, Neuchâtel, Neuchâtel, Switzerland)
Url	/artefacts/600/

∨ The object



Fig. 1: Wedge part of an altar crown suspension (after Hadzic 2008, 2),

Credit HE-Arc CR.

∨ Description and visual observation

Description of the artefact	Construction element used for suspension of an altar crown (Fig. 1) covered with a thin corrosion layer.
Type of artefact	Supporting structure
Origin	Abbey of Rheinau, Zürich, Zurich, Switzerland
Recovering date	1720 AD
Chronology category	Modern Times
chronology tpq	<input type="text" value="1720"/> A.D. ▾
chronology taq	<input type="text" value=""/> ---- ▾
Chronology comment	
Burial conditions / environment	Indoor atmosphere
Artefact location	Abbey of Rheinau, Zürich, Zurich

Owner	Canton of Zurich, Zurich
Inv. number	None
Recorded conservation data	Not conserved (machine brushed)

Complementary information

Nothing to report.

Study area(s)



Fig. 2: Location of sampling area,

Credit HE-Arc CR.


Binocular observation and representation of the corrosion structure

Stratigraphic representation: none.

MiCorr stratigraphy(ies) – Bi

Sample(s)

Fig. 3: Micrograph of the cross-section of the sample taken from the wedge part showing the location of Figs. 5 to 13. Steel areas are delimited by black dotted lines,

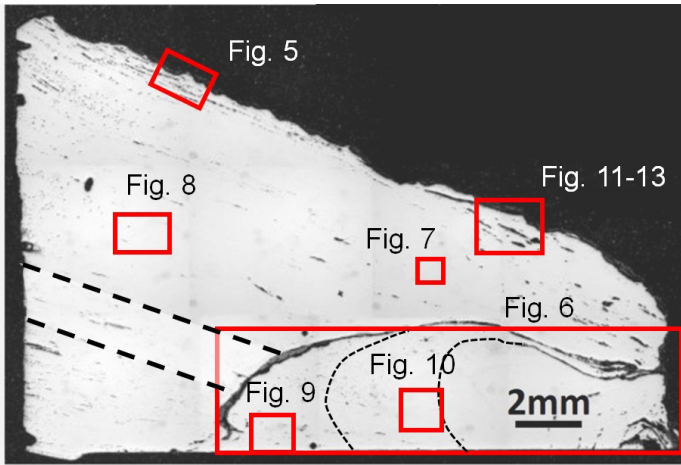

Credit HE-Arc CR.

Description of sample	This sample is a section from the end of the wedge part (Fig. 2). The corrosion crust appears on the top side on Fig. 3.
Alloy	P-rich iron and hypoeutectoid steel
Technology	Annealed after (hot) rolling
Lab number of sample	RHE1-NR
Sample location	Empa (Marianne Senn)
Responsible institution	IWT (Naila Hadzic), Wallisellen, Zurich
Date and aim of sampling	January 2008, material testing and security report

Complementary information

Nothing to report.

∨ Analyses and results

Analyses performed:

Metallography (nital etched and etched with Oberhoffer's reagent), Vickers hardness testing, LA-ICP-MS, SEM/EDS.

∨ Non invasive analysis

∨ Metal

The remaining metal (M1) is a P-rich iron (0.3-0.45 mass%) with two zones (M3) consisting of soft, hypoeutectoid steel (C content 0.2 mass%) (Fig. 3 and Table 1). The P-rich iron contains many elongated slag inclusions of various sizes forming parallel rows (Figs. 3 and 5). The number of slag inclusions is higher than in bloomery iron and their distribution is typical for rolled metal. A crack, partially filled by hammer scale and corrosion products, indicates a poor quality welding seam (Fig. 3). Below the inclusions the curve produced by forging is highlighted. In good quality wrought iron slag inclusions are small, uniformly distributed and have identical compositions (Boesenberg 2006, 622). This is not the case in this sample, but can be explained by the rudimentary rolling process of the 18th century. The chemical composition of the slag inclusions shows that iron oxides dominate, beside phosphorus oxide, calcium oxide and silica (Table 2). The composition is typical for slag formed by hearth refining of pig iron (Dillmann and L'Héritier 2007). During this process, the pig iron is oxidised. The oxidising elements are Si, P, Mn, V and Cr. The analyzed slag

inclusions contain more Fe than most published ones. The high P content is similar to published examples from the 18th century (Dillmann and L'Héritier 2007, 1820). The high calcium oxide content, which is often combined with high silica content, could originate from the addition of both materials while refining the pig iron to better eliminate the P. In one of our measurements, only the silica concentration is high (Table 2). This can be interpreted as resulting from the addition of sand during forging. Etching with Oberhoffer's reagent outlines the thick welding seam (M2, Fig. 6), the rolling direction and the P segregation. Etching with nital mainly shows a ferritic structure (Fig. 7). The grains vary in size (between ASTM grain sizes of 4 to 8) and are recrystallized. The ferrite shows local ghost structures, and includes Neumann bands and some needles (Figs. 8 and 9). These are typical structures of P-rich iron. The ghost structure is formed by a fast recrystallization of P-rich iron after heating above 1000°C. The Neumann bands indicate cold working. The hypoeutectoid steel consists of ferrite with lamellar pearlite (Fig. 10). The average hardness of the metal is HV1 185 (in the Empa test report a mean of HV10 175 was determined). The areas close to the welding seam are harder (ca. HV1 210). The calculated tensile strength based on HV1 175 is about 544N/mm².

Elements	Ni/Co	Al	P	Ti	V	Cr	Mn	Co	Ni	Cu	As	Mo	Ag	Sn	Sb	W	C* mass%
Median mg/kg	3.1	<	3400	<	40	80	20	270	840	340	400	20	<	10	10	<	0-0.2
Detection limit mg/kg	-	4	65	8	1	10	2	1	3	1	2	3	1	0.4	1	3	-
RSD %	3	1	16	-	168	55	114	6	6	7	19	7	-	17	22	-	-


*visually estimated

Table 1: Chemical composition of the P-rich iron. Method of analysis: LA-ICP-MS, Lab Inorganic Chemistry, ETH.

Structure	Location	MgO	Al ₂ O ₃	SiO ₂	P ₂ O ₅	SO ₃	K ₂ O	CaO	TiO ₂	V ₂ O ₅	Cr ₂ O ₃	MnO	FeO	Total	SiO ₂ /Al ₂ O ₃
n. d.	steel	0.8	0.7	6.1	23	<	<	9.0	<	1.9	1.7	0.7	60	105	8.3
Glassy matrix	steel	1.4	<	17	18	<	<	<	<	<	<	0.7	66	105	67
White plates (wustite)	steel	<	<	1.1	<	<	<	<	0.9	<	<	<	97	101	3.4
Droplet (wustite)	steel	<	1.3	0.9	1.1	<	<	0.6	<	2.4	<	<	99	106	0.7
Slag with plates and droplets	steel	1.0	0.6	12	21	<	<	2.7	<	0.6	<	<	69	107	20
n. d.	steel	0.8	2.0	12	29	1.0	1	14	0.6	<	<	1	47	109	5.7
Wustite in glass	P-rich iron	0.6	0.7	6.5	17	0.8	<	4.0	<	0.9	<	0.9	77	109	9.2
n. d.	P-rich iron	<	0.8	1.3	4.6	<	<	<	0.6	3.0	1.5	<	94	106	1.6
n. d.	P-rich iron	0.8	1.1	5.4	11	<	<	3.8	0.9	3.9	<	0.7	81	108	5.1
n. d.	P-rich iron	<	1	1.6	3.7	<	<	0.8	0.8	5.3	0.7	<	84	99	1.6
n. d.	P-rich iron	1.2	<	8.9	13	<	<	2.7	<	2.3	0.7	0.9	68	99	18
n. d.	P-rich iron	0.8	1.2	8.7	23	<		9.8	<	0.7	<	1.3	54	99	7.6

Table 2: Chemical composition of the slag inclusions (mass %). Method of analysis: SEM/EDS, Laboratory of Analytical Chemistry, Empa.


Fig. 5: Micrograph of the metal sample from Fig. 3 (reversed picture, detail), unetched, bright field. In white the metal, in grey the corrosion layer. There are numerous slag inclusions in the metal all orientated to form rows. Some inclusions are empty, probably due to sample preparation,

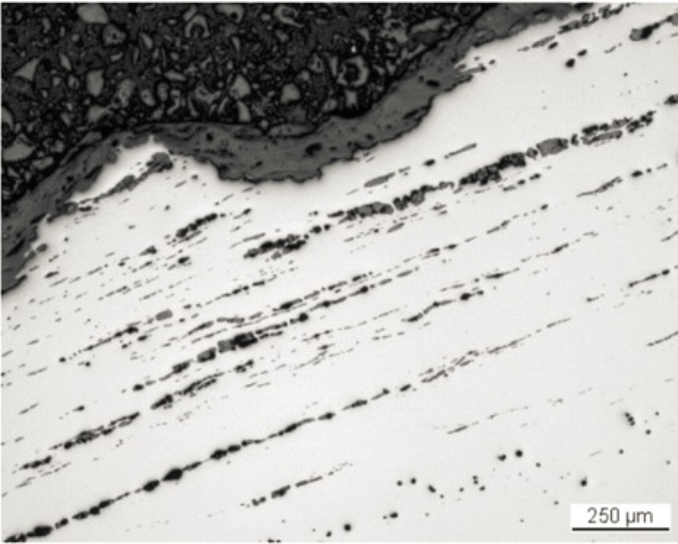


Credit HE-Arc CR.



Credit HE-Arc CR.

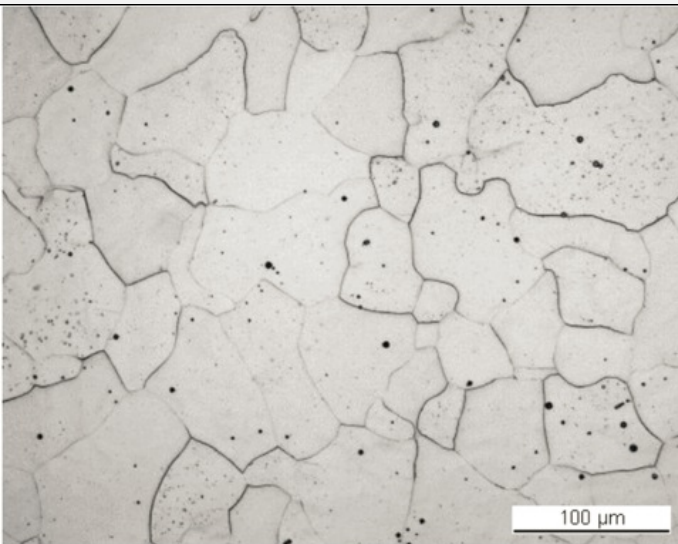

Credit HE-Arc CR.

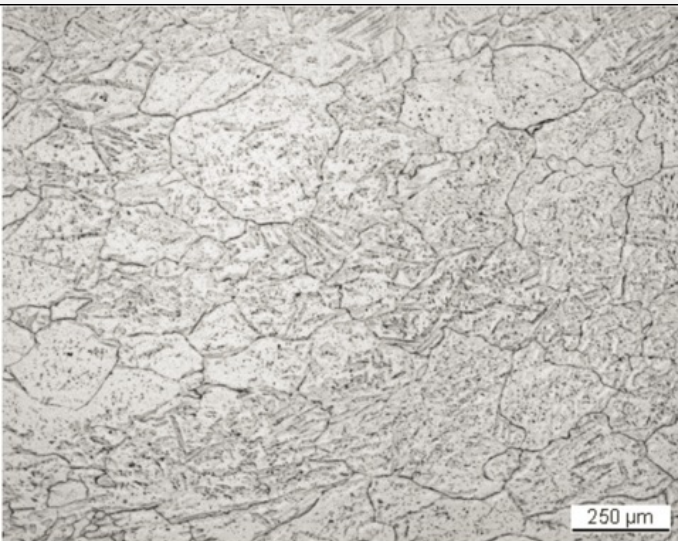

Credit HE-Arc CR.

Fig. 6: Micrograph of the metal sample from Fig. 3 (reversed picture, detail), etched with Oberhoffer's reagent, bright field. The etching shows the P segregation near the welding line and outlines the irregular P distribution in the metal (white P-rich areas, dark P-poor areas),

Fig. 7: Micrograph of the metal sample from Fig. 3 (detail), nital etched, bright field. The metal presents a ferritic structure,

Fig. 8: Micrograph of the metal sample from Fig. 3 (detail), nital etched, bright field. The ferrite shows a ghost structure with needles,

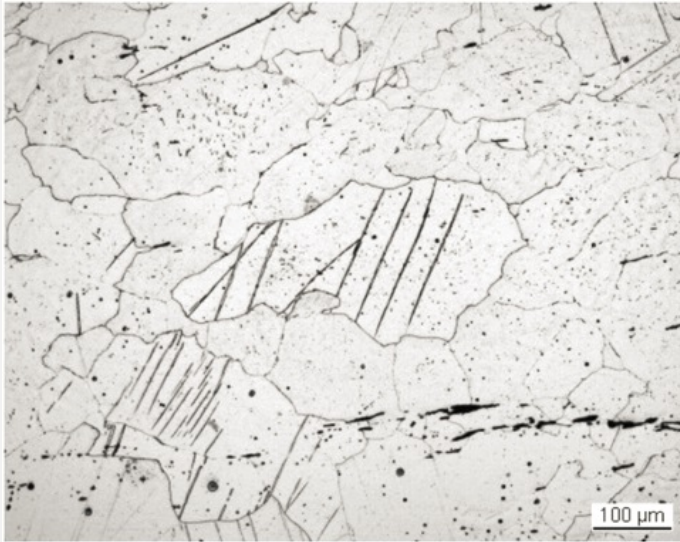


Fig. 9: Micrograph of the metal sample from Fig. 3 (detail), nital etched, bright field. The ferrite grains include Neumann bands,

Credit HE-Arc CR.

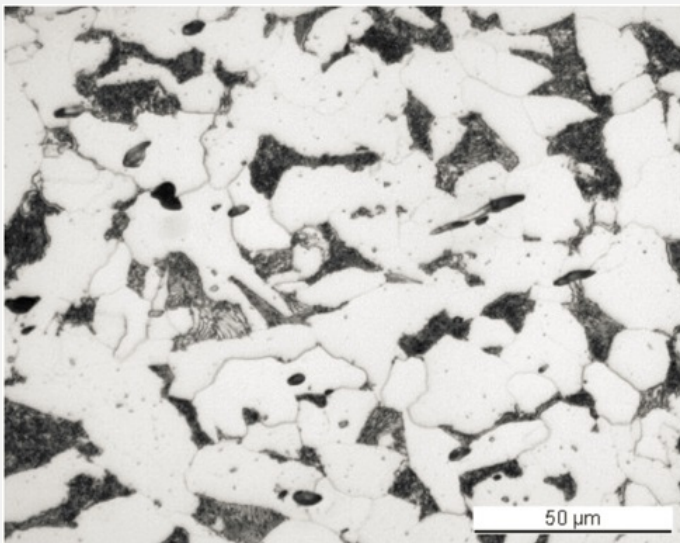


Fig. 10: Micrograph of the metal sample from Fig. 3 (detail), nital etched, bright field. The hypoeutectoid steel is constituted of ferrite in white and lamellar pearlite (in black),

Credit HE-Arc CR.

Microstructure	Recrystallized grains, Newman bands, ghost structure
First metal element	Fe
Other metal elements	P

Complementary information

Nothing to report.


⌵ Corrosion layers

The corrosion crust is thin and irregular. It is restricted to one of the three surfaces. In bright field, the corrosion layer seems homogeneous and appears medium-grey with a fissure parallel to the metal surface (Fig. 11). Under polarised light the corrosion products near the metal surface are mostly red-orange (CP3), whereas in the outer layer they appear orange-brown (CP1) (Fig. 12). A dark-brown zone is visible between them (CP2) and contains bright inclusions with a chemical composition similar to wüstite (Table 3). This corresponds to corroded slag inclusions (internal markers). Chemical analysis (Table 3) and elemental mapping (Fig. 13) do not highlight a difference in composition of the corrosion layers, except for the corroded slag inclusions.


Elements	O	S	Fe	Total
Inner part, dark-brown corrosion layer (CP2)	34	<	61	96
Inner part, orange corrosion products (average of 2 similar analyses) (CP3)	34	<	64	99

Bright inclusion	23		83	106
Middle, orange corrosion products	36	0.6	64	101
Outer orange corrosion layer (average of 3 similar analyses) (CP1)	34	0.7	62	96

Table 3: Chemical composition (mass %) of the corrosion crust (from Fig. 12). Method of analysis: SEM/EDS, Laboratory of Analytical Chemistry, Empa.

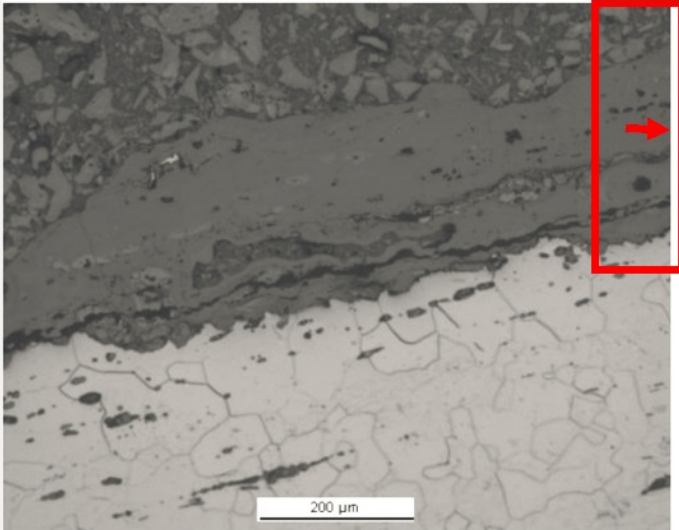

Credit HE-Arc CR.

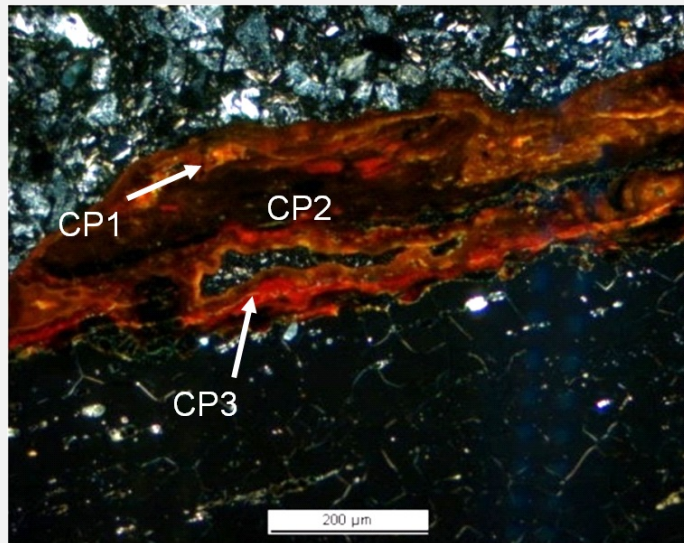


Credit HE-Arc CR.

Fig. 11: Micrograph showing the metal - corrosion layer interface from Fig. 3 (reversed picture, detail), unetched, bright field. The grey corrosion layer contains bright inclusion rows. The area selected for elemental chemical distribution (Fig. 13) is marked by the red rectangle which extends beyond the micrograph,

Fig. 12: Micrograph (same as Fig. 11) corresponding to the stratigraphy of Fig. 4, unetched, polarised light. We observe from bottom to top: a red-orange inner corrosion layer (CP3), followed by a dark-brown intermediate layer (CP2) and an orange-brown outer layer (CP1),

Fig. 13: SEM image, BSE-mode, and elemental chemical distribution of the selected area from Fig. 11 (inversed, detail). Method of examination: SEM/EDS, Laboratory of Analytical Chemistry, Empa,

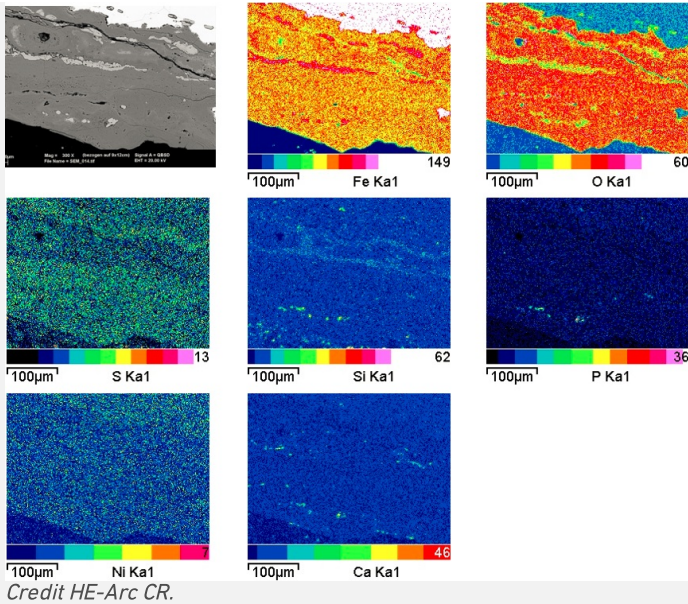

Corrosion form Uniform - pitting

Corrosion type ?

Complementary information

Nothing to report.

∨ MiCorr stratigraphy(ies) – CS

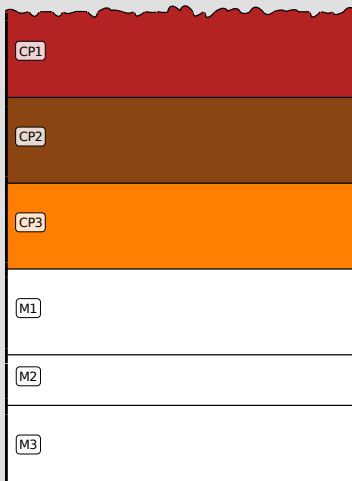


Fig. 4: Stratigraphic representation of the sample taken from the wedge part in cross-section using the MiCorr application. The characteristics of the strata are only accessible by clicking on the drawing that redirects you to the search tool by stratigraphy representation. This representation can be compared to Fig. 12, Credit HE-Arc CR.

∨ Synthesis of the binocular / cross-section examination of the corrosion structure

Corrected stratigraphic representation: none.

∨ Conclusion

The wedge was rolled, hammered and annealed from a refined, P-rich wrought iron. It was welded from at least two parts. The C distribution is irregular and shows a zone of soft steel in the middle of the iron. The indoor corrosion seems superficial, but it is possible that the sample surface was cleaned before embedding (Hadzic 2008).

References

References on object and sample

References sample

1. Hadzic, N. (2008) Prüfbericht Nr. 448'051, Empa.

References on analytic methods and interpretation

2. Boesenberg, J.S. (2006) Wrought iron from the USS Monitor: mineralogy, petrology and metallography. *Archaeometry* 48-4, 613-631.

3. Dillmann, P., L'Héritier, M. (2007) Slag inclusions analyses for studying ferrous alloys employed in French medieval building: supply of materials and diffusion of smelting process. *Journal of Archaeological Science* 34, 1810-1823.

4. ASTM E112-13: Standard Test Methods for Determining Average Grain Size.